

General Information

Date & Time: 15, Jan, 2026 12:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	14,545
Registration No.	GBK1090	Chassis No.	PA1B18F38S4286640
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



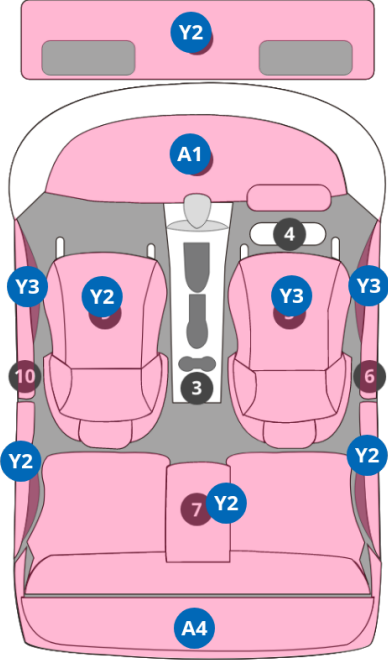
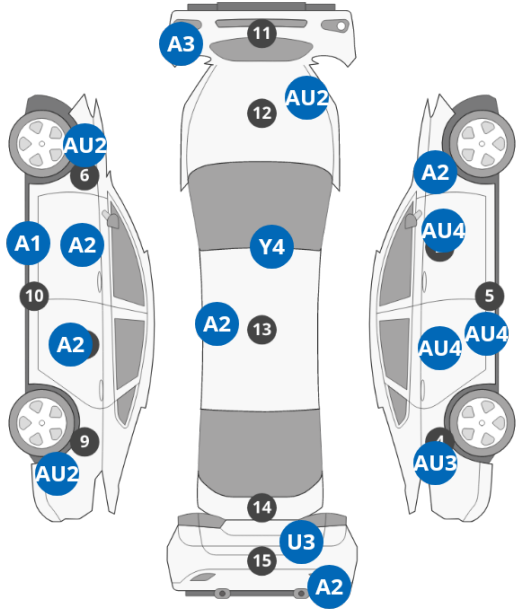
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.9	115	98	117
2	Boot Lid	98.7	88	100	108
3	Roof	98.6	100	94	100/101
4	Left Front Fender	97.3	96	96	100
5	Left Front Door	106.0	104	107	107
6	Center Panel Left				
7	Left Rear Door	107.3	113	105	104
8	Left Back Panel	112.3	120	111	106
9	Right Front Fender	99.2	104	99	94
10	Right Front Door	95.4	97	94	95
11	Center Panel Right				
12	Right Rear Door	100.8	93	99	111
13	Right Back Panel	96.0	92	91	105

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Large</p>	<p>Remarks Front Windshield - Damaged - Large / Roof - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/with jack No tools/With warranty booklet/with seat cover/front windshield damage</p>