

General Information

Date & Time: 12, Dec, 2025 06:02

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	18,711
Registration No.	FAS6752	Chassis No.	PA1B18F39R4279013
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



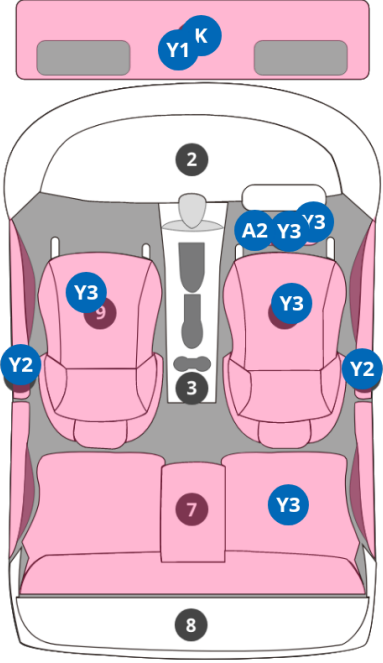
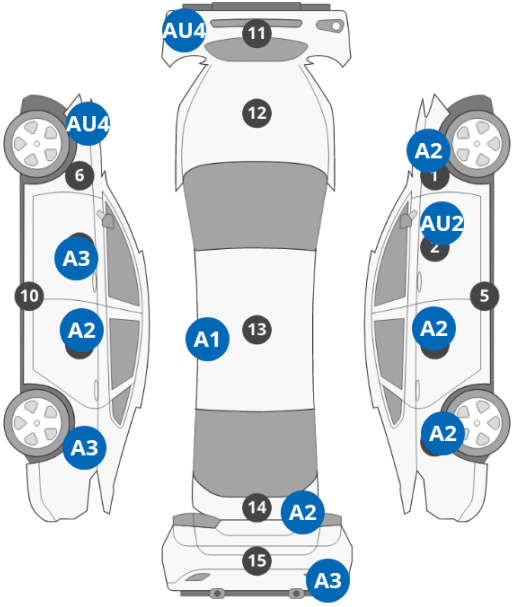
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.6	121	107	119
2	Boot Lid	109.6	102	109	118
3	Roof	98.0	100	100	92/100
4	Left Front Fender	101.1	105	100	99
5	Left Front Door	103.6	105	102	104
6	Center Panel Left				
7	Left Rear Door	109.6	119	110	100
8	Left Back Panel	113.3	121	115	104
9	Right Front Fender	106.8	99	100	121
10	Right Front Door	103.1	114	98	98
11	Center Panel Right				
12	Right Rear Door	104.8	96	100	118
13	Right Back Panel	109.6	105	115	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Animal Hair - Yes / Ceiling - Grime - Minimal / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Both side mirror are different colors. Front bumper cover panel at right side partially missing. Gap at front bumper. With warranty booklet, spare tire, and jack. Without tools and seat cover. 1 key. With LTO plate.</p>