


General Information

Date & Time: 12, Dec, 2025 15:33

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	48,275
Registration No.	DBH9521	Chassis No.	PA1B18F36P4208509
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition

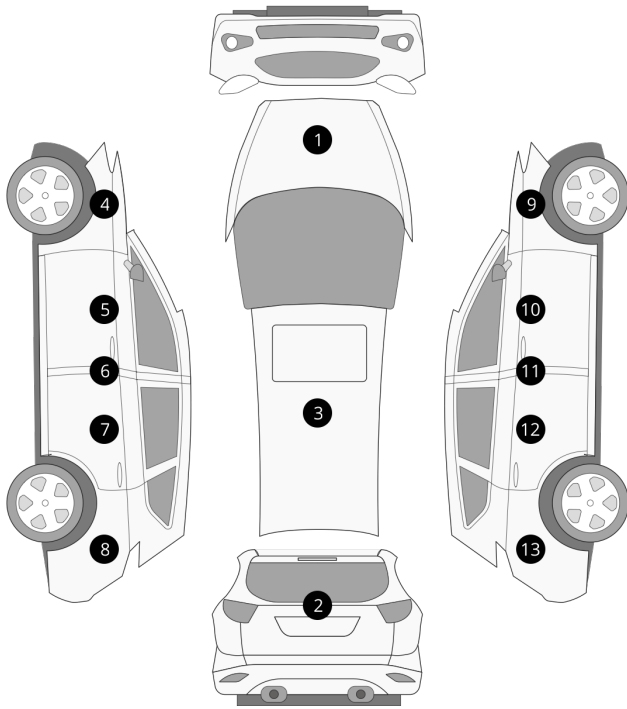

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	255.3	235	263	268
2	Boot Lid	192.0	256	153	167
3	Roof	401.7	605	209	621/172
4	Left Front Fender	169.0	175	163	169
5	Left Front Door	212.6	263	166	209
6	Center Panel Left				
7	Left Rear Door	160.6	171	152	159
8	Left Back Panel	664.0	712	858	422
9	Right Front Fender	295.3	176	425	285
10	Right Front Door	169.3	242	130	136
11	Center Panel Right				
12	Right Rear Door	179.6	143	235	161
13	Right Back Panel	975.0	676	1,260	989

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Cut, Crack - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Mat Other - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Left Center Pillar - Condition of Welding ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes

With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, no reverse camera, foul smell, possible flooded, warning lamps on, scratch headlight and tail light, Worn Tires and Sparetire, plate and room light issue.