

General Information

Date & Time: 15, Dec, 2025 15:47

Make	Mitsubishi	Model	Mirage
YOM	2023	Odo Meter Reading	14,041
Registration No.	EAI8399	Chassis No.	PAEA13MJPPA016110
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



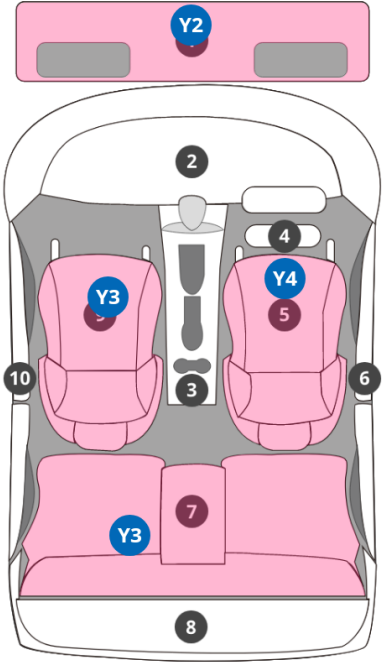
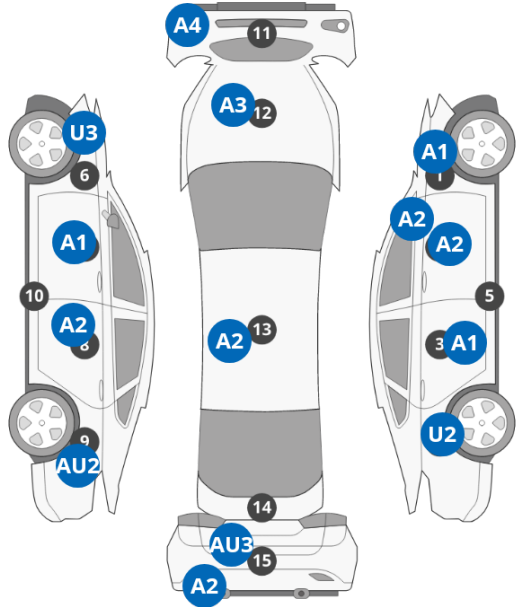
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	108	116	115
2	Boot Lid	112.6	110	120	108
3	Roof	104.7	108	106	107/98
4	Left Front Fender	117.0	123	114	114
5	Left Front Door	110.0	111	110	109
6	Center Panel Left				
7	Left Rear Door	109.3	120	100	108
8	Left Back Panel	119.3	132	119	107
9	Right Front Fender	117.3	126	107	119
10	Right Front Door	113.0	114	114	111
11	Center Panel Right				
12	Right Rear Door	106.0	116	96	106
13	Right Back Panel	109.6	103	104	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch - Small / (L) Front Fender, Molding - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and No tools/No reverse camera/with warranty booklet/Rear seat issue/No fog light