

General Information

Date & Time: 13, Dec, 2025 08:55

Make	Mitsubishi	Model	Montero SPT
YOM	2019	Odo Meter Reading	86,077
Registration No.	KAD3335	Chassis No.	MMBGJKR10KH015945
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



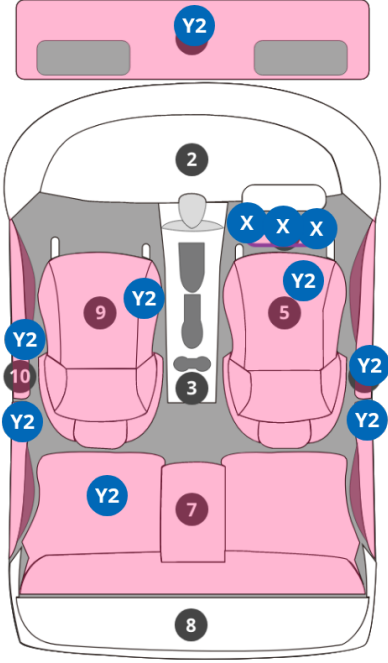
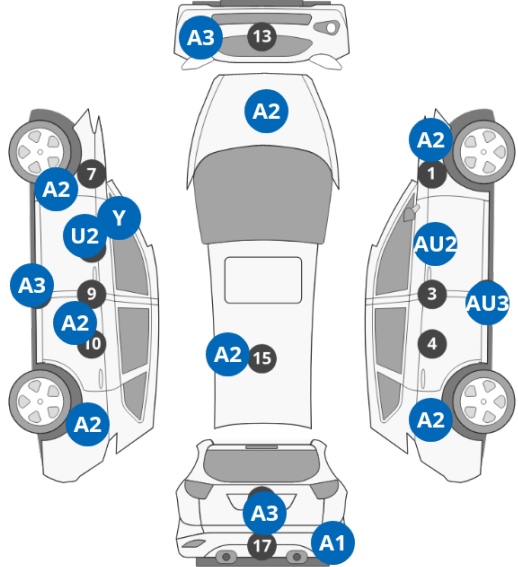
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	120	121	126
2	Boot Lid	104.2	112	101	100
3	Roof	94.4	90	90	98/100
4	Left Front Fender	118.0	120	111	123
5	Left Front Door	106.0	110	102	106
6	Center Panel Left				
7	Left Rear Door	101.7	110	102	93
8	Left Back Panel	99.5	101	99	98
9	Right Front Fender	113.6	124	105	112
10	Right Front Door	109.3	113	103	112
11	Center Panel Right				
12	Right Rear Door	106.0	103	108	107
13	Right Back Panel	106.6	115	108	97

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small</p>	<p>Remarks (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Crack - Cracks / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Headlight not working. Yellow stains at the interior. Aircon issue. Small crack and gap at left side mirror. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With LTO plate.</p>