

General Information

Date & Time: 15, Dec, 2025 15:54

Make	Ford	Model	Ranger
YOM	2018	Odo Meter Reading	106,646
Registration No.	CAI7692	Chassis No.	MNCUMFF50HW784429
CC	3.2	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Orange		

Body / Panel Condition



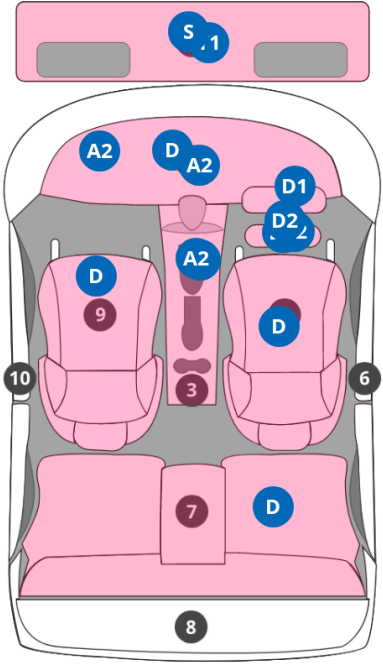
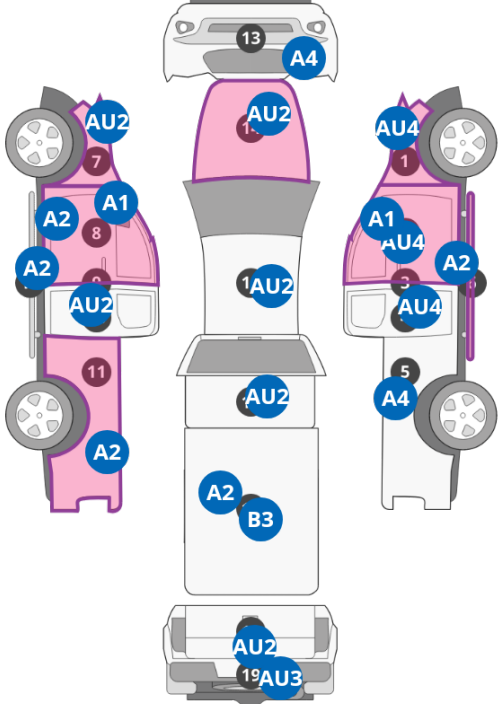
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.9	108	102	96
2	Boot Lid	71.8	71	72	72
3	Roof	127.8	89	198	118/106
4	Left Front Fender	130.3	126	123	142
5	Left Front Door	144.6	146	148	140
6	Center Panel Left				
7	Left Rear Door	146.6	157	141	142
8	Left Back Panel	288.3	166	366	333
9	Right Front Fender	335.3	227	499	280
10	Right Front Door	108.8	108	99	120
11	Center Panel Right				
12	Right Rear Door	100.5	98	95	109
13	Right Back Panel	153.0	155	130	174

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / Rear Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Knobs - Worn, Peel, Crack - Small / Display, Audio System - Stuck - Yes / Room Mirror - Stuck - Yes / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Minimal / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Side Gate - Scratch - Large / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Cargo Bed Floor - Modified - Medium / Cargo Bed Floor - Scratch - Small / Cab Back Panel - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : D	Functional Evaluation : E
<p>Remarks Right Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire, No Tools and Jack and Warranty booklet, No spare key, worn tires, adhesive marks on vehicle, Abnormal vibration on engine, Abnormal shiftshock, Abnormal noise, foul smell, plate light and Room light issue, air-conditioned issue, warning lamps on, windows control issue, tail light issue, cab back panel issue, hydraulic Stay issue in hood.