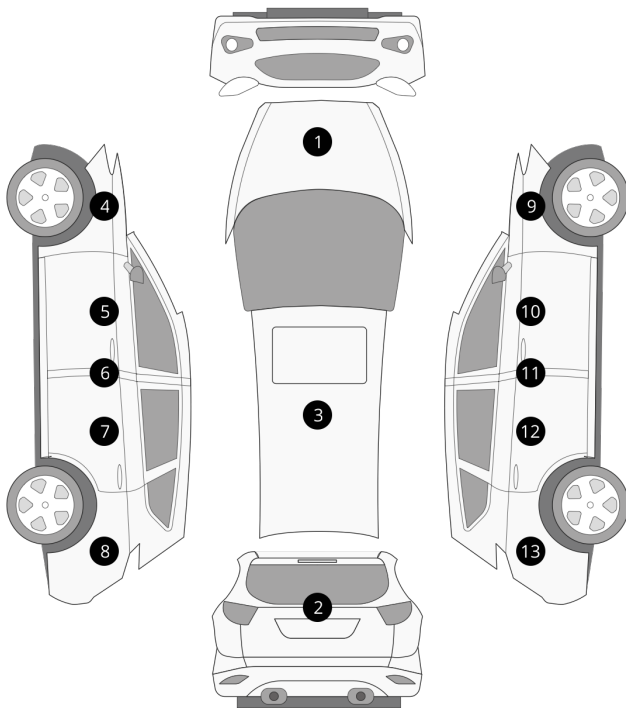


General Information

Date & Time: 06, Jan, 2026 12:34

Make	Mitsubishi	Model	Montero SPT
YOM	2024	Odo Meter Reading	11,930
Registration No.	DBO5224	Chassis No.	MMBGJKR10RH00382
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



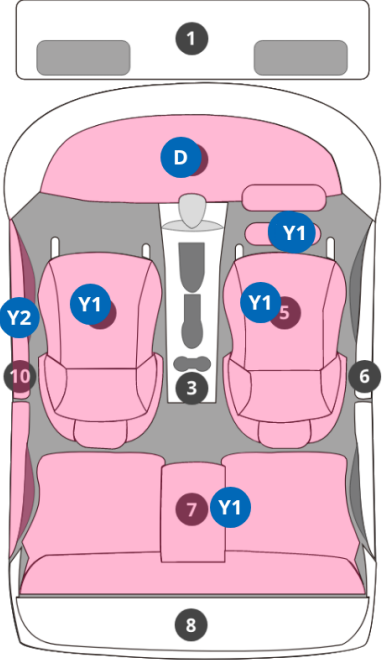
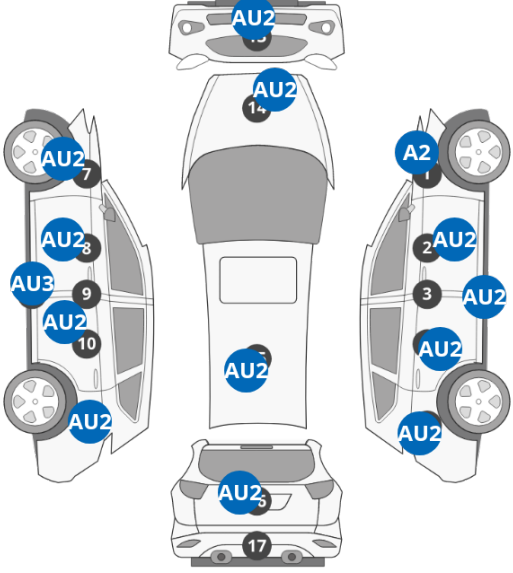
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.3	107	113	120
2	Boot Lid	118.6	107	132	117
3	Roof	110.0	103	109	114/114
4	Left Front Fender	112.0	112	111	113
5	Left Front Door	124.0	117	126	129
6	Center Panel Left				
7	Left Rear Door	112.3	107	120	110
8	Left Back Panel	118.6	117	118	121
9	Right Front Fender	99.7	66	117	116
10	Right Front Door	125.6	130	133	114
11	Center Panel Right				
12	Right Rear Door	128.0	109	122	153
13	Right Back Panel	128.6	114	118	154

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with manual & warranty booklet, with reverse camera, no tools & jack, no spare tire, no spare key, scratches on taillight & headlight.</p>