

General Information

Date & Time: 15, Dec, 2025 09:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,358
Registration No.	BAF9937	Chassis No.	PA1B18F35R4247949
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



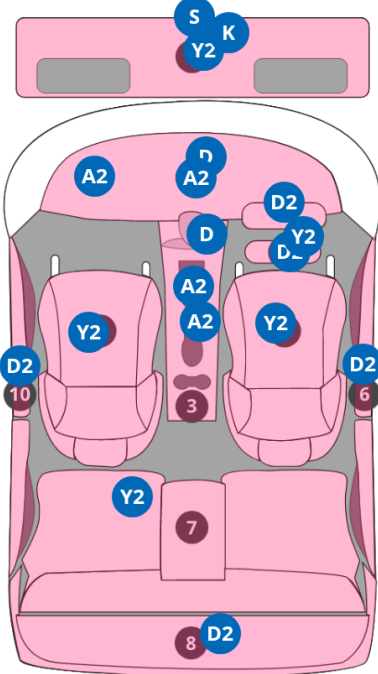
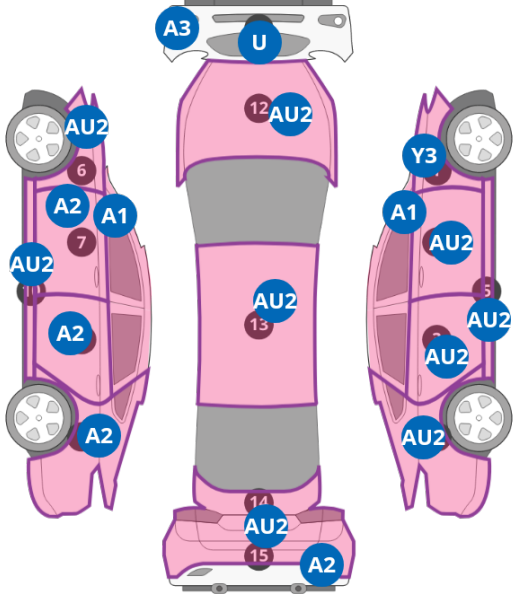
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	118	108	115
2	Boot Lid	115.6	113	122	112
3	Roof	105.8	110	97	108/109
4	Left Front Fender	102.6	105	103	100
5	Left Front Door	106.6	104	111	105
6	Center Panel Left				
7	Left Rear Door	112.0	108	109	119
8	Left Back Panel	138.6	117	188	111
9	Right Front Fender	708.6	1,007	222	897
10	Right Front Door	335.0	473	304	228
11	Center Panel Right				
12	Right Rear Door	466.6	249	283	868
13	Right Back Panel	519.0	537	596	424

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks</p> <p>(L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Knobs - Worn, Peel, Crack - Small / Room Mirror - Stuck - Yes / Rear Seat - Grime - Small / Trunk Room - Loose, Deformed - Small</p>	<p>Remarks</p> <p>(R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Roof - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Member (Bolted) - Dent - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : D	Functional Evaluation : E
<p>Remarks</p> <p>Right Front Pillar - Condition of Welding ? - Yes / Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside Panel (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks</p> <p>Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire and Warranty booklet, No spare key, no Tools and Jack, Scratch headlight and tail light, Worn Tires and Spare tire, Scratch and Crack Tail light and Headlight, foul smell, warning lamps on, power window switch issue, side mirror issue, air-conditioned issue, plate light and Room light issue,