

General Information

Date & Time: 17, Dec, 2025 10:40

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	23,654
Registration No.	CCA8776	Chassis No.	PA1B18F3XR4254458
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



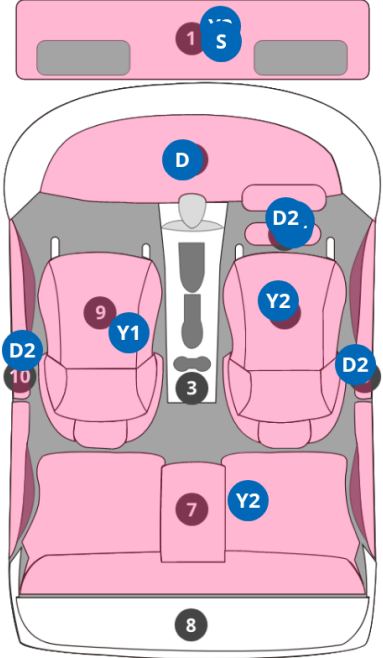
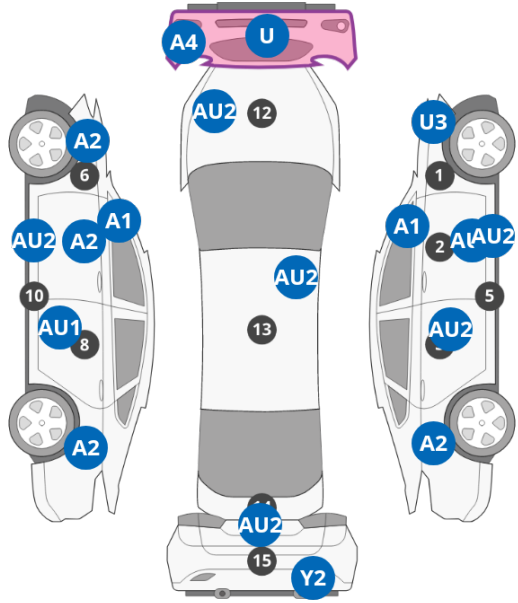
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	119	113	117
2	Boot Lid	109.0	106	110	111
3	Roof	99.4	109	103	93/93
4	Left Front Fender	72.5	74	74	69
5	Left Front Door	93.5	95	92	94
6	Center Panel Left				
7	Left Rear Door	102.8	112	105	92
8	Left Back Panel	103.3	105	103	102
9	Right Front Fender	98.1	97	96	101
10	Right Front Door	104.4	110	98	105
11	Center Panel Right				
12	Right Rear Door	102.7	94	104	110
13	Right Back Panel	111.0	106	108	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes</p>	<p>Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate, Jack and Incomplete Tools, Warranty booklet, No Sparetire, Scratch and Crack Tail light and Headlight, foglight issue, plate light and Room light issue, Foul smell, possible flooded, worn tires.</p>