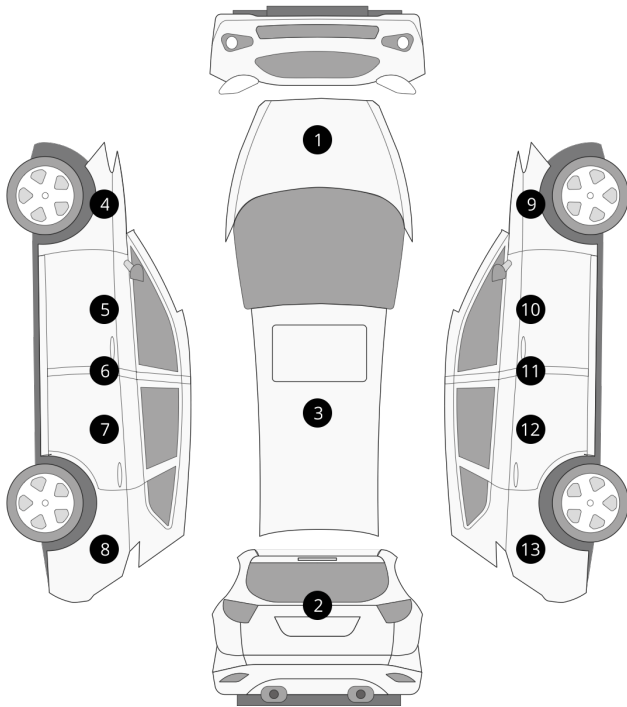


General Information

Date & Time: 17, Dec, 2025 10:39

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	8,511
Registration No.	CCG7007	Chassis No.	PA1B18F32S4289386
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



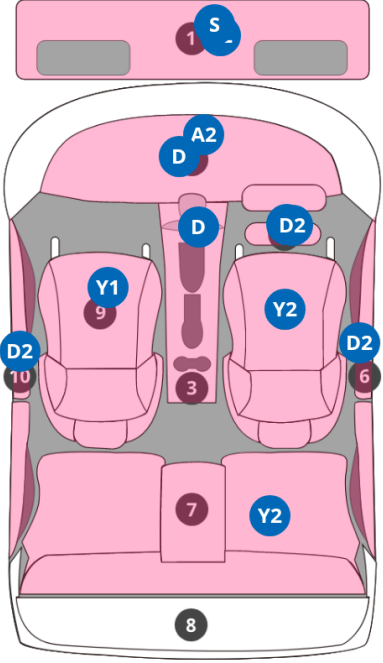
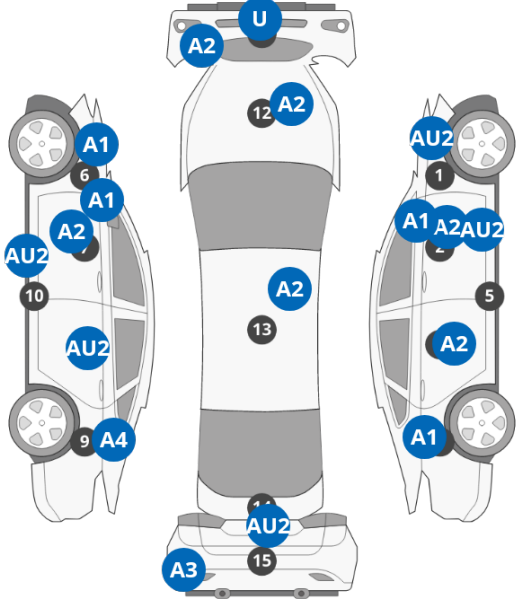
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	124	111	116
2	Boot Lid	111.3	119	104	111
3	Roof	103.2	103	100	105/105
4	Left Front Fender	110.3	103	106	122
5	Left Front Door	104.6	104	103	107
6	Center Panel Left				
7	Left Rear Door	102.5	96	106	106
8	Left Back Panel	103.7	106	108	97
9	Right Front Fender	111.0	108	117	108
10	Right Front Door	106.6	108	107	105
11	Center Panel Right				
12	Right Rear Door	115.0	111	113	121
13	Right Back Panel	117.0	111	113	127

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Rear Seat - Grime - Small	Remarks Member (Bolted) - Dent - Yes / (L) Rear Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With LTO plate, No warranty booklet and Sparetire and Jack and Tools, No Spare key, Scratch and Crack Tail light and Headlight, worn tires, foul smell, plate and room light issue.