

General Information

Date & Time: 15, Dec, 2025 18:45

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	24,870
Registration No.	CBB5976	Chassis No.	MR0AB8DD8P5036950
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



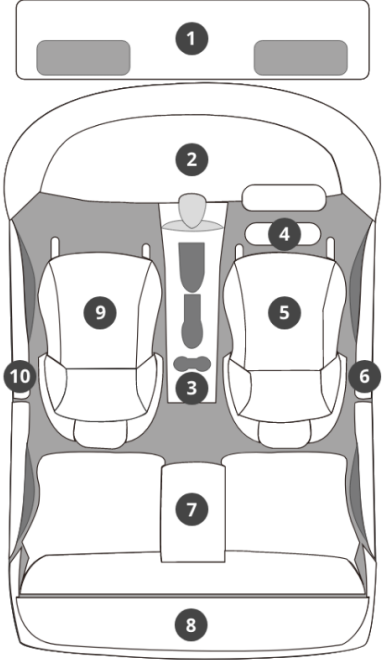
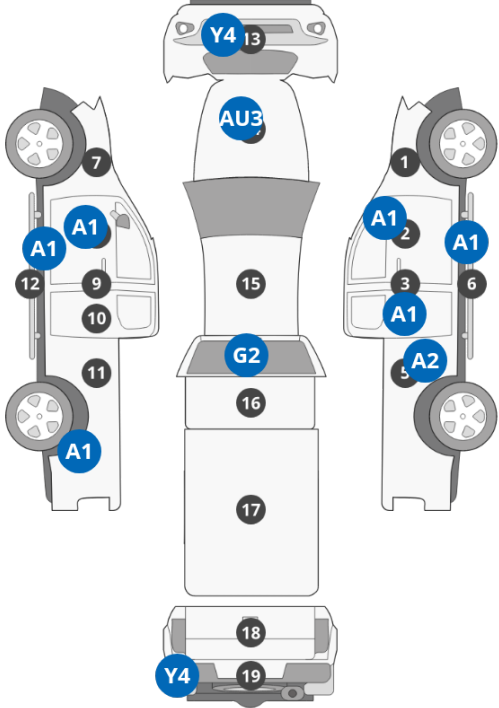
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	126	116	118
2	Boot Lid	84.2	83	84	86
3	Roof	110.2	105	99	106/131
4	Left Front Fender	101.1	100	107	97
5	Left Front Door	101.6	99	101	105
6	Center Panel Left	78.6	73	94	69
7	Left Rear Door	101.5	104	99	102
8	Left Back Panel	108.0	106	103	115
9	Right Front Fender	104.9	99	98	118
10	Right Front Door	103.3	106	104	100
11	Center Panel Right	116.3	63	93	193
12	Right Rear Door	101.2	100	102	102
13	Right Back Panel	108.0	103	122	99

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Defects not found	Remarks (R) Center Panel - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Side Gate - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes

Inspector Notes
With Lto plate, with warranty booklet, with spare tire , no jack and tools, scratches on headlights, Crack taillight