

General Information

Date & Time: 15, Dec, 2025 15:53

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	12,708
Registration No.	NKO3176	Chassis No.	PA2JA8EM8S0153255
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



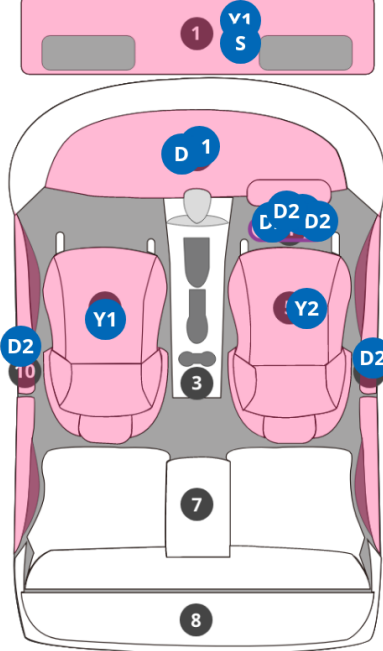
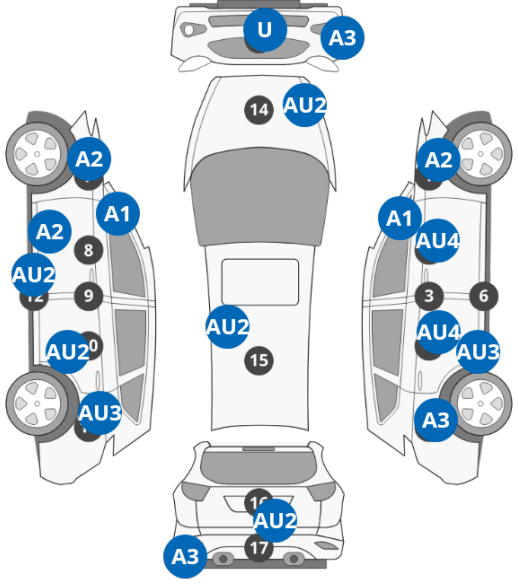
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.5	83	117	93
2	Boot Lid	106.6	111	106	103
3	Roof	96.2	99	83	102/101
4	Left Front Fender	96.3	103	99	87
5	Left Front Door	98.5	96	101	99
6	Center Panel Left				
7	Left Rear Door	103.5	108	107	96
8	Left Back Panel	108.3	112	114	99
9	Right Front Fender	97.3	99	98	95
10	Right Front Door	99.1	97	99	101
11	Center Panel Right				
12	Right Rear Door	109.0	105	108	114
13	Right Back Panel	110.6	106	110	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Minimal / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>	
<p>With LTO plate and Sparetire and Jack and Incomplete Tools, No warranty booklet, No spare key, worn tires and Sparetire, Scratch and Crack Tail light and Headlight, foul smell, headlight issue.</p>	