

General Information

Date & Time: 05, Jan, 2026 13:32

Make	Nissan	Model	Navara
YOM	2023	Odo Meter Reading	32,062
Registration No.	KAP8971	Chassis No.	MNTCCAD23Z0015475
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



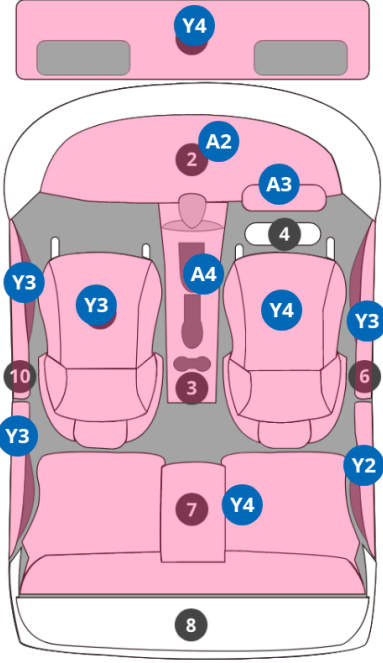
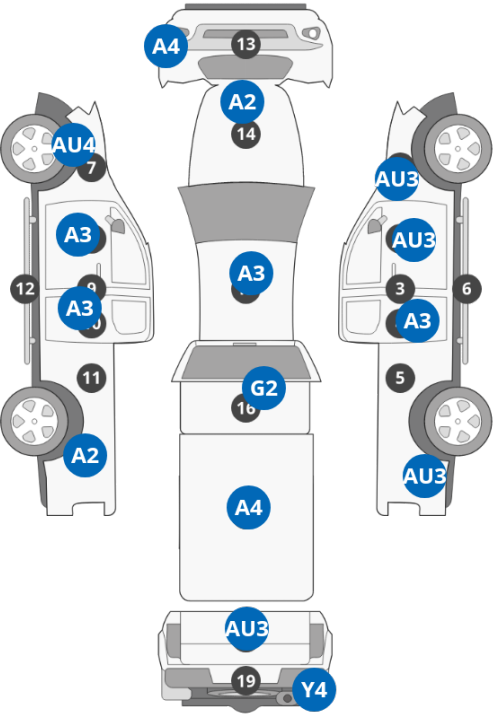
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	104	100	92
2	Boot Lid	100.4	116	89	96
3	Roof	94.1	81	94	99/102
4	Left Front Fender	102.7	104	107	97
5	Left Front Door	90.5	94	87	91
6	Center Panel Left	69.3	78	71	60
7	Left Rear Door	90.5	94	89	88
8	Left Back Panel	95.1	93	94	99
9	Right Front Fender	99.6	99	110	90
10	Right Front Door	87.5	84	91	88
11	Center Panel Right	69.5	82	68	59
12	Right Rear Door	94.6	96	99	89
13	Right Back Panel	93.9	99	93	90

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Large / Ceiling - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Side Gate - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Side Gate - Scratch - Small / Rear Gate - Scratch & Dent - Medium / Rear Windshield - Scratch, Stone chip - Small / Cargo Bed Floor - Scratch - Large / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with reverse camera/with warranty booklet/with jack and tools/ No spare key/possible flooding/steering wheel issue/with check engine/interior dirty</p>