

General Information

Date & Time: 15, Dec, 2025 15:49

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,059
Registration No.	DBR8651	Chassis No.	PA1B18F35T4279560
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



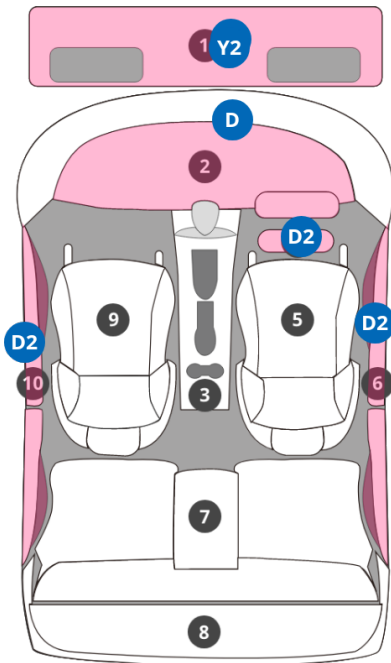
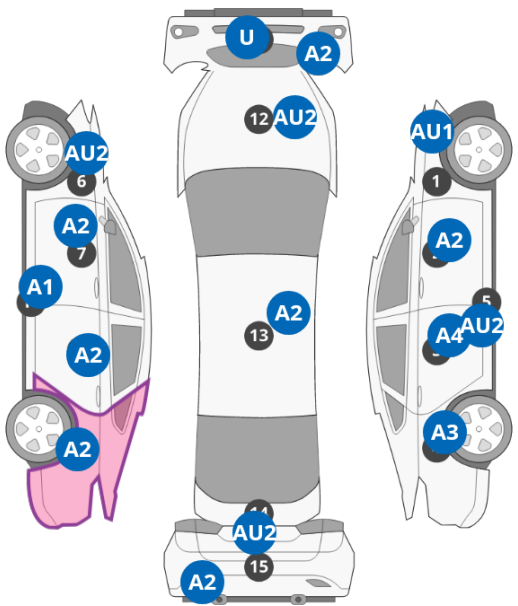
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	110	111	103
2	Boot Lid	116.0	107	112	129
3	Roof	101.6	128	100	84/95
4	Left Front Fender	104.3	107	108	98
5	Left Front Door	101.3	100	101	103
6	Center Panel Left				
7	Left Rear Door	131.6	115	102	178
8	Left Back Panel	105.7	114	98	105
9	Right Front Fender	107.6	105	108	110
10	Right Front Door	93.0	93	91	96
11	Center Panel Right				
12	Right Rear Door	114.4	137	95	111
13	Right Back Panel	100.5	101	101	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Smell - Yes / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire, No Tools and Jack and Warranty booklet, No spare key, warning lamps on, plate and room light issue, air-conditioned issue, worn tires and Sparetire.</p>