

General Information

Date & Time: 15, Dec, 2025 15:51

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	3,428
Registration No.	CCQ1202	Chassis No.	PA1B18F38S4288100
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



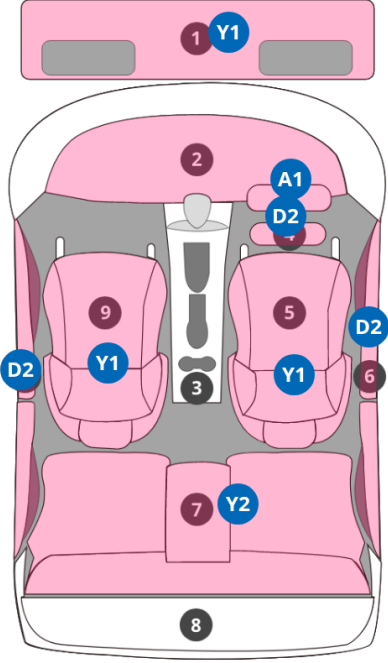
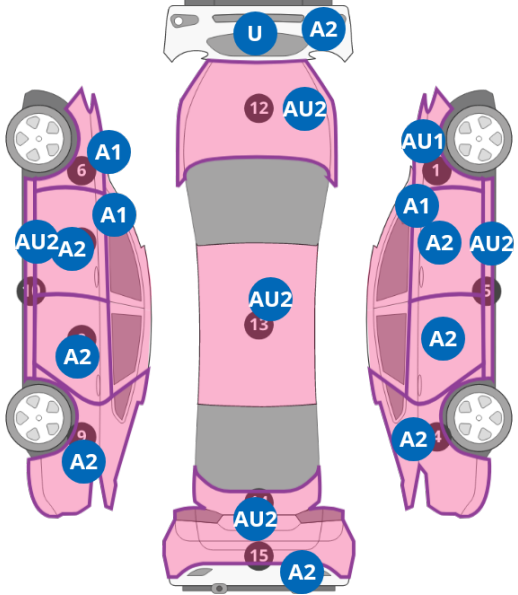
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	101	109	107
2	Boot Lid	98.4	96	97	102
3	Roof	93.1	91	96	90/96
4	Left Front Fender	92.2	92	92	92
5	Left Front Door	121.0	94	173	96
6	Center Panel Left				
7	Left Rear Door	103.0	103	108	98
8	Left Back Panel	771.6	1,275	835	205
9	Right Front Fender	101.2	108	93	103
10	Right Front Door	96.7	100	94	96
11	Center Panel Right				
12	Right Rear Door	108.0	113	102	109
13	Right Back Panel	101.5	98	99	108

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Worked - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender - Replaced - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Replaced - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Roof - Scratch & Dent - Small</p>
Frame Evaluation : D	Functional Evaluation : A
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Condition of Welding ? - Yes / Right Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside Panel (Front Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Inside (Rear Side) - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Left Front Pillar - Condition of Welding ? - Yes / Left Center Pillar - Condition of Welding ? - Yes / Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes / Right Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Center Pillar - Condition of Welding ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

Inspector Notes

With LTO plate and Spare tire and Jack and Incomplete Tools, with warranty booklet, No spare key, worn tires and Spare tire, Scratch and Crack Tail light and Headlight, foul smell, Plate light and Room light issue.