

## General Information

Date & Time: 15, Dec, 2025 09:39

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	23,785
<b>Registration No.</b>	CCG5148	<b>Chassis No.</b>	PA1B18F37R4273016
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Black		

## Body / Panel Condition



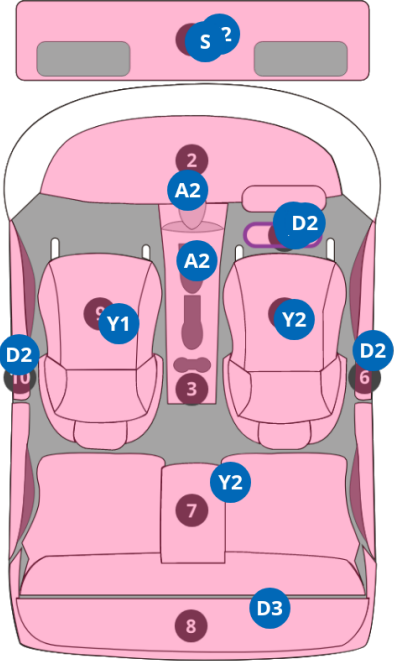
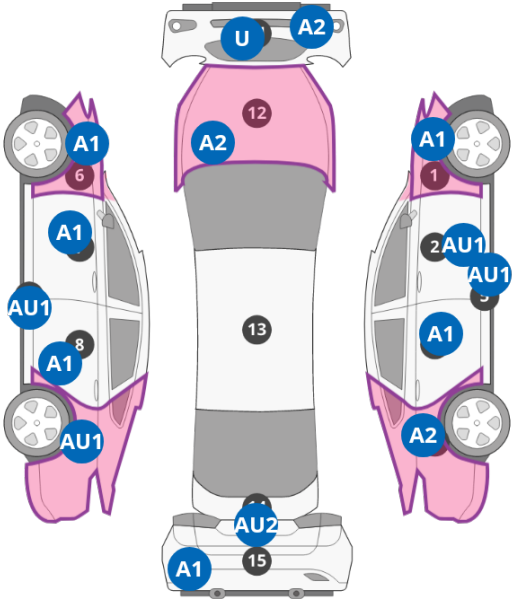
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	114	102	109
2	Boot Lid	96.5	96	92	101
3	Roof	94.7	97	93	90/100
4	Left Front Fender	96.6	98	96	96
5	Left Front Door	107.0	123	94	104
6	Center Panel Left				
7	Left Rear Door	97.0	101	97	93
8	Left Back Panel	103.6	107	102	102
9	Right Front Fender	102.9	110	98	101
10	Right Front Door	98.5	108	98	90
11	Center Panel Right				
12	Right Rear Door	101.6	104	100	101
13	Right Back Panel	104.8	103	97	115

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Mat Other - Missing - Yes / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Loose, Deformed - Medium</p>	<p><b>Remarks</b>          (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (L) Front Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b>          Defects not found</p>	<p><b>Remarks</b>          Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate and warranty booklet, No Sparetire, No Tools and Jack, Scratch and Crack Tail light and Headlight, worn tires, Plate light issue and room light issue, foul smell.</p>