

## General Information

Date & Time: 15, Dec, 2025 19:16

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	22,274
<b>Registration No.</b>	BAF3070	<b>Chassis No.</b>	MHKAA4DF5FPJ081353
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Orange		

## Body / Panel Condition



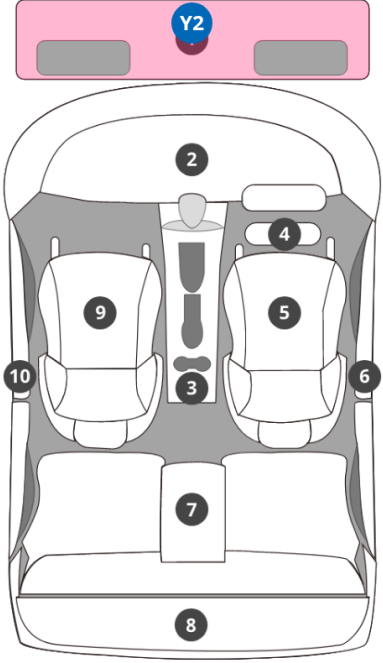
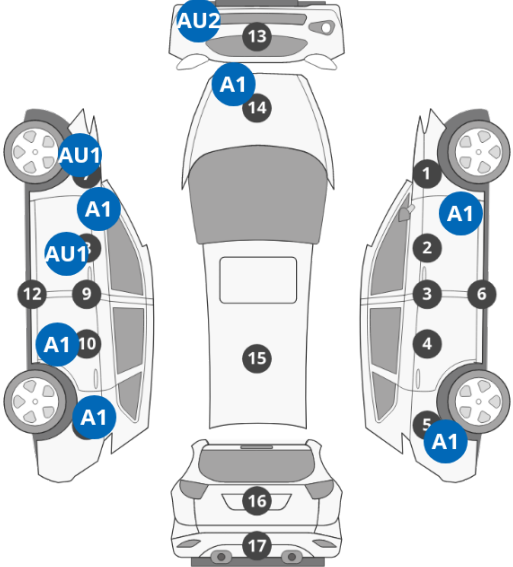
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.2	105	111	100
2	Boot Lid	97.2	92	105	95
3	Roof	87.7	83	94	81/93
4	Left Front Fender	88.3	90	86	88
5	Left Front Door	94.4	96	95	92
6	Center Panel Left				
7	Left Rear Door	92.8	100	87	92
8	Left Back Panel	88.0	88	84	93
9	Right Front Fender	103.4	105	109	96
10	Right Front Door	104.9	99	106	110
11	Center Panel Right				
12	Right Rear Door	103.1	98	104	107
13	Right Back Panel	99.6	101	93	105

Overall Evaluation :

**A**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> Ceiling - Grime - Small	<b>Remarks</b> (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Defects not found

<b>Inspector Notes</b>
With Lto plate, with warranty booklet, with spare and jack, 2keys, no tools,scratches on headlight