

General Information

Date & Time: 05, Jan, 2026 15:05

Make	Nissan	Model	NP300 Navara
YOM	2019	Odo Meter Reading	238,737
Registration No.	LAG3264	Chassis No.	MNTCC4D23Z0052315
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



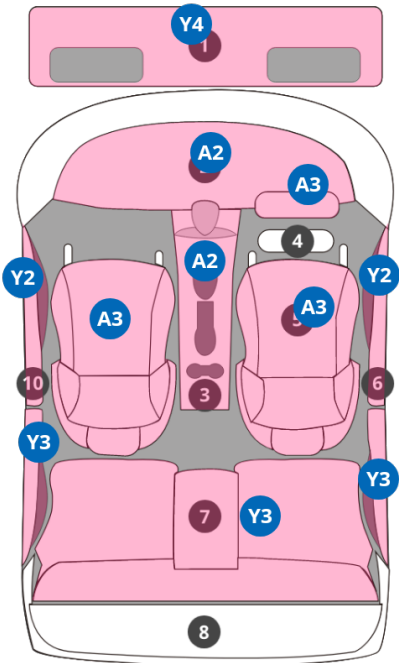
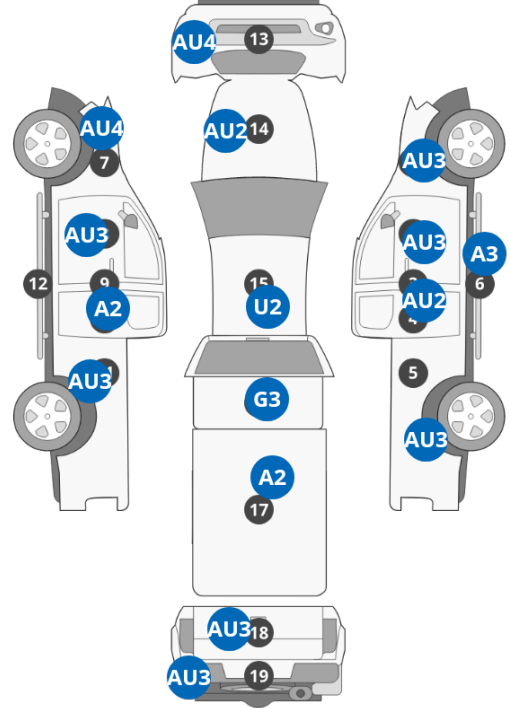
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.1	102	94	83
2	Boot Lid	96.6	93	98	99
3	Roof	95.6	77	81	130/95
4	Left Front Fender	91.5	95	93	87
5	Left Front Door	87.6	89	87	87
6	Center Panel Left	71.3	71	79	65
7	Left Rear Door	88.3	93	90	82
8	Left Back Panel	94.8	89	91	105
9	Right Front Fender	91.2	93	99	82
10	Right Front Door	88.0	86	89	90
11	Center Panel Right	70.5	79	79	54
12	Right Rear Door	86.5	87	88	84
13	Right Back Panel	92.5	90	96	91

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Cut, Crack - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Seat - Cut, Crack - Medium / (L) Front Trim - Grime - Small / Ceiling - Grime - Large / Steering Wheel - Worn, Peel, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small	Remarks (L) Side Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Medium / Rear Windshield - Scratch, Stone chip - Medium / Roof - Dent - Small / Cargo Bed Floor - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/No jack and tools//with reverse camera/with warranty booklet/with check engine/ceiling dirty/power window issue