

General Information

Date & Time: 16, Jan, 2026 12:50

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	9,559
Registration No.	NHS7507	Chassis No.	PA1B18F3XR4265721
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



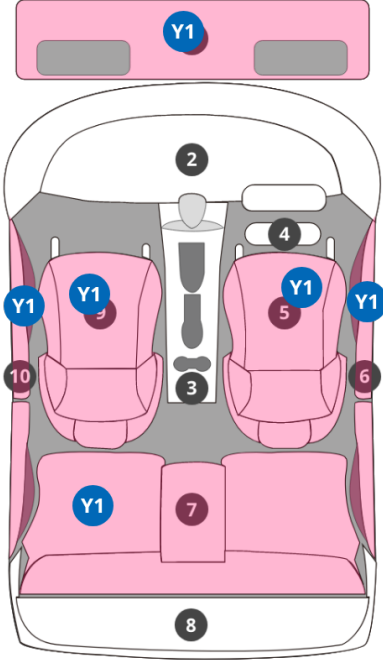
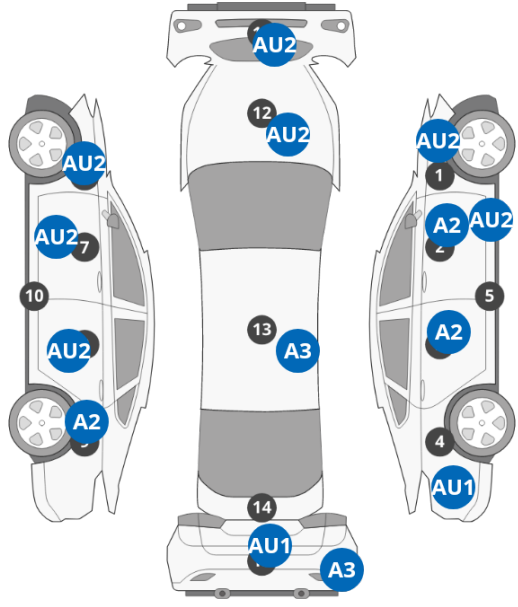
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	129	104	121
2	Boot Lid	116.0	114	116	118
3	Roof	108.0	106	104	104/118
4	Left Front Fender	102.5	100	100	108
5	Left Front Door	99.1	96	110	92
6	Center Panel Left				
7	Left Rear Door	99.9	106	97	97
8	Left Back Panel	105.2	119	100	97
9	Right Front Fender	103.0	108	98	103
10	Right Front Door	117.0	107	140	104
11	Center Panel Right				
12	Right Rear Door	102.6	101	100	107
13	Right Back Panel	121.4	97	126	141

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal</p>	<p>Remarks (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Roof - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with incomplete tools and jack, with manual booklet, with reverse camera, with spare key, no warranty booklet, scratches on taillight maplight issue.</p>