

General Information

Date & Time: 17, Dec, 2025 08:09

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	30,539
Registration No.	DBP1480	Chassis No.	MHFAA1BY2R0026756
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



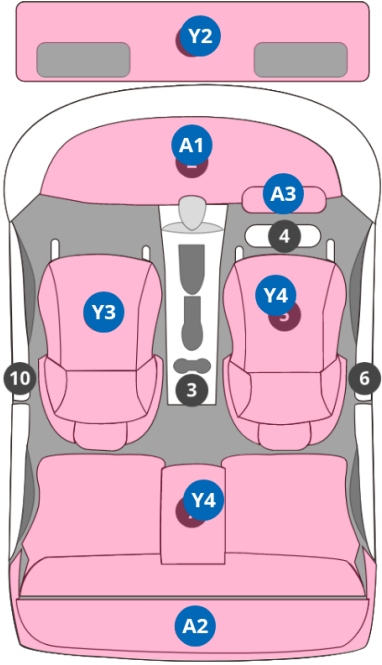
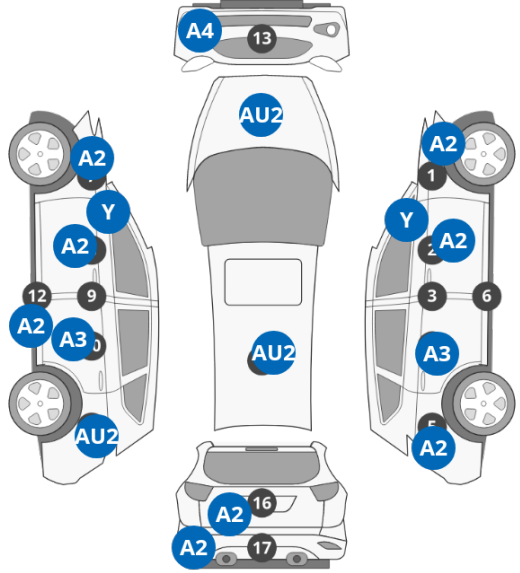
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	107	105	102
2	Boot Lid	90.0	87	98	86
3	Roof	118.2	118	122	124/109
4	Left Front Fender	97.0	103	89	99
5	Left Front Door	114.6	106	114	124
6	Center Panel Left				
7	Left Rear Door	113.6	122	104	115
8	Left Back Panel	111.5	126	111	98
9	Right Front Fender	105.3	111	104	101
10	Right Front Door	114.0	121	112	109
11	Center Panel Right				
12	Right Rear Door	112.6	117	108	113
13	Right Back Panel	109.6	110	102	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Ceiling - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal	Remarks (L) Mirror - Crack - Damaged / (R) Mirror - Crack - Damaged / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/No spare key/No jack and tools/left and right side mirror issue/with reverse camera/with warranty booklet/interior dirty