

General Information

Date & Time: 16, Dec, 2025 15:09

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,310
Registration No.	DBU5767	Chassis No.	PA1B18F37S4288248
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



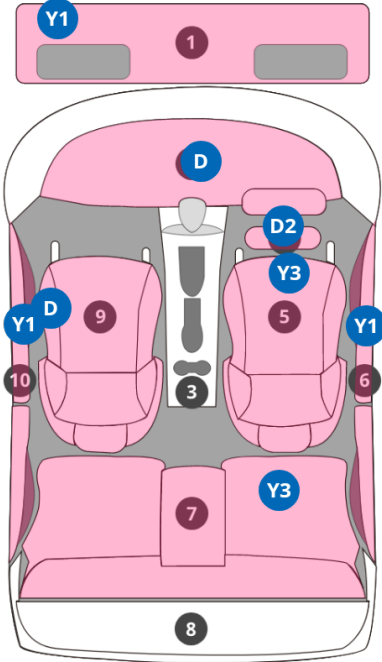
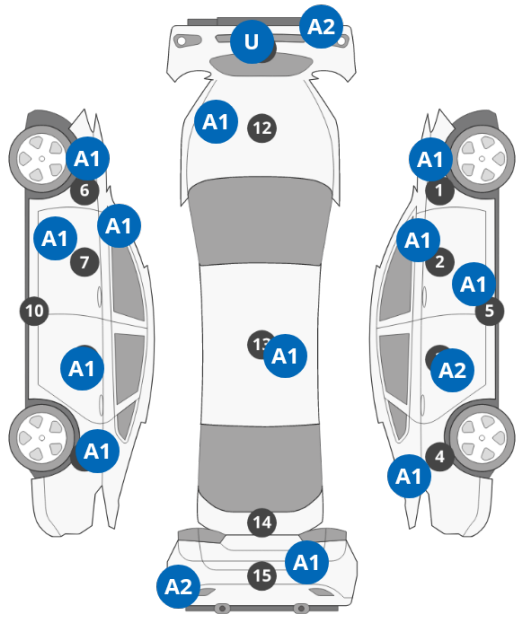
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.6	118	117	154
2	Boot Lid	113.0	115	113	111
3	Roof	105.7	111	112	93/107
4	Left Front Fender	159.6	175	157	147
5	Left Front Door	129.6	149	121	119
6	Center Panel Left				
7	Left Rear Door	106.6	104	113	103
8	Left Back Panel	109.0	116	109	102
9	Right Front Fender	110.6	113	112	107
10	Right Front Door	105.6	108	105	104
11	Center Panel Right				
12	Right Rear Door	109.3	101	108	119
13	Right Back Panel	106.6	106	107	107

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light