

General Information

Date & Time: 16, Dec, 2025 15:07

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,107
Registration No.	EAJ2213	Chassis No.	PA1B18F30R4252573
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



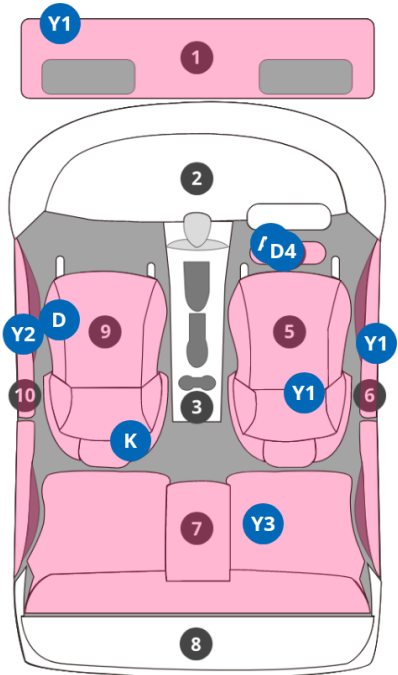
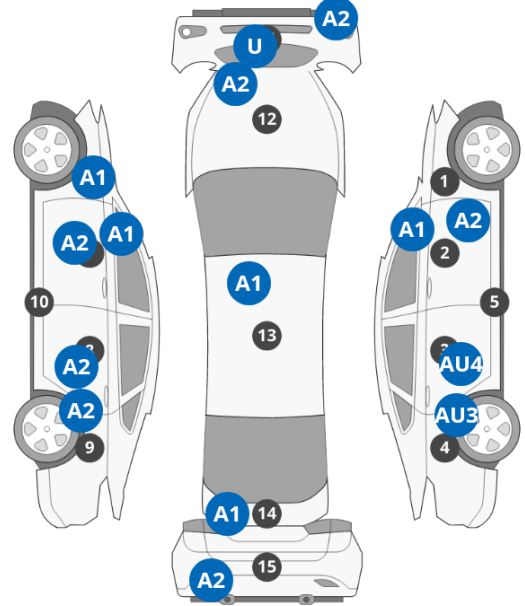
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	124	105	123
2	Boot Lid	107.3	106	103	113
3	Roof	96.6	99	99	90/99
4	Left Front Fender	107.3	108	105	109
5	Left Front Door	106.7	109	112	99
6	Center Panel Left				
7	Left Rear Door	101.7	106	102	97
8	Left Back Panel	105.0	111	100	104
9	Right Front Fender	219.6	149	204	306
10	Right Front Door	101.3	101	97	106
11	Center Panel Right				
12	Right Rear Door	99.0	97	97	103
13	Right Back Panel	100.8	100	100	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / Overall Interior - Animal Hair - Yes / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Condition of Welding ? - Yes	Remarks Defects not found

Inspector Notes
with warranty booklet, jack and tools, no spare tire, with LTO plate, scratches on tail light