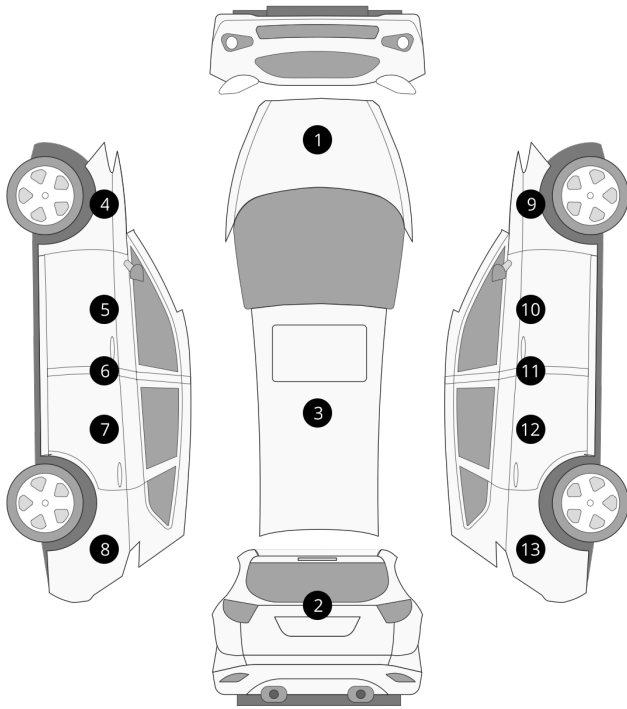


## General Information

Date & Time: 20, Dec, 2025 11:02

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	237,365
<b>Registration No.</b>	NFC4661	<b>Chassis No.</b>	PA2JA8EM0M0094219
<b>CC</b>	2.8	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



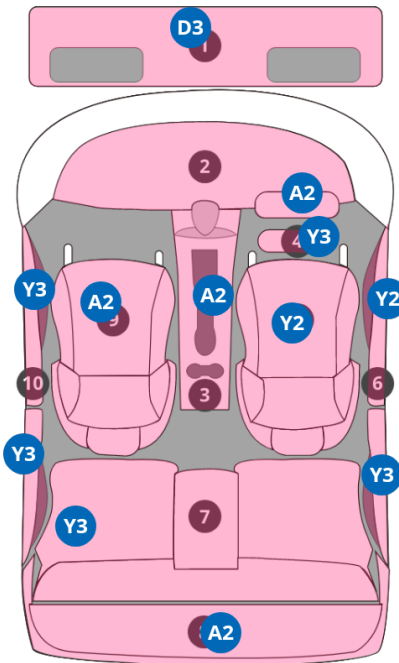
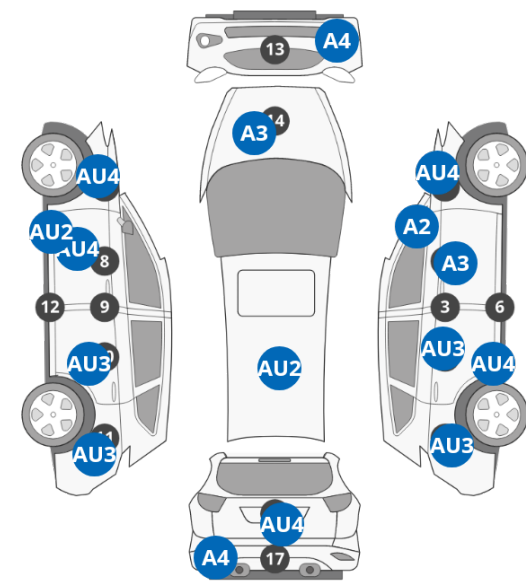
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.0	85	120	99
2	Boot Lid	102.3	104	101	102
3	Roof	94.0	104	93	95/85
4	Left Front Fender	99.0	97	100	100
5	Left Front Door	105.8	99	102	116
6	Center Panel Left				
7	Left Rear Door	104.6	108	104	102
8	Left Back Panel	107.0	106	110	105
9	Right Front Fender	98.8	102	97	97
10	Right Front Door	97.0	94	99	99
11	Center Panel Right				
12	Right Rear Door	98.6	98	100	98
13	Right Back Panel	106.6	99	111	110

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>D</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<b>Remarks</b> (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Cut, Crack - Small / (L) Front Floor Mat - Grime - Medium / Steering Wheel - Worn, Peel, Crack - Small / Ceiling - Crinkle - Medium / Knobs - Worn, Peel, Crack - Small	<b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<b>Remarks</b> Defects not found	<b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

<b>Inspector Notes</b>
with LTO plate/with spare tire/No spare key/fog light issue/No reverse camera/with jack and tools/No warranty booklet/plate light issue