

General Information

Date & Time: 17, Dec, 2025 10:12

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,334
Registration No.	NHM4852	Chassis No.	PA1B18F31S4287175
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



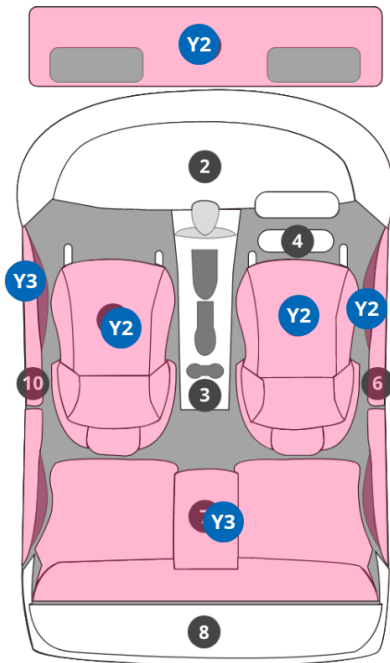
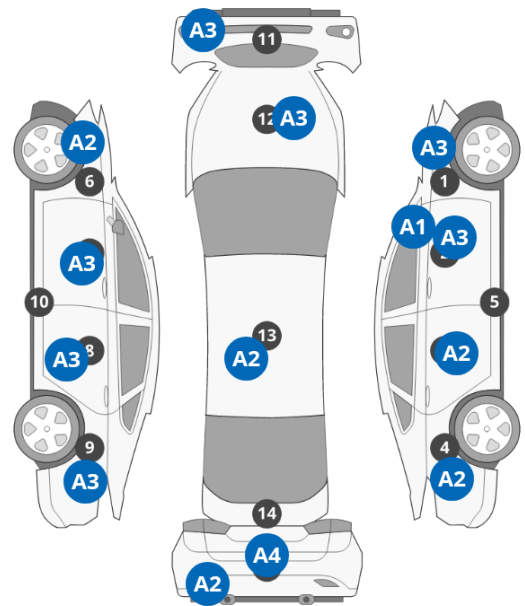
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	113	96	129
2	Boot Lid	101.9	102	99	105
3	Roof	90.8	99	91	85/89
4	Left Front Fender	96.3	96	95	99
5	Left Front Door	95.8	94	94	100
6	Center Panel Left				
7	Left Rear Door	105.0	108	104	103
8	Left Back Panel	109.6	114	108	107
9	Right Front Fender	96.6	95	96	99
10	Right Front Door	93.2	98	90	91
11	Center Panel Right				
12	Right Rear Door	96.6	89	94	107
13	Right Back Panel	97.5	93	100	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small	Remarks Roof - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate/with spare tire/with 1 spare key/with reverse camera/with jack and incomplete tools/with warranty booklet