

General Information

Date & Time: 17, Dec, 2025 08:33

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	61,671
Registration No.	NHQ2674	Chassis No.	MHFAA1BY1P0022081
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



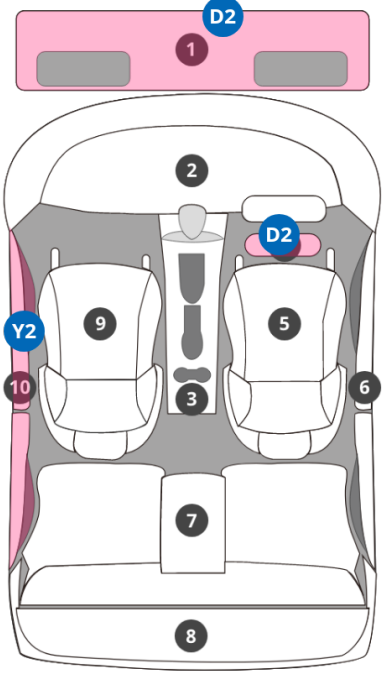
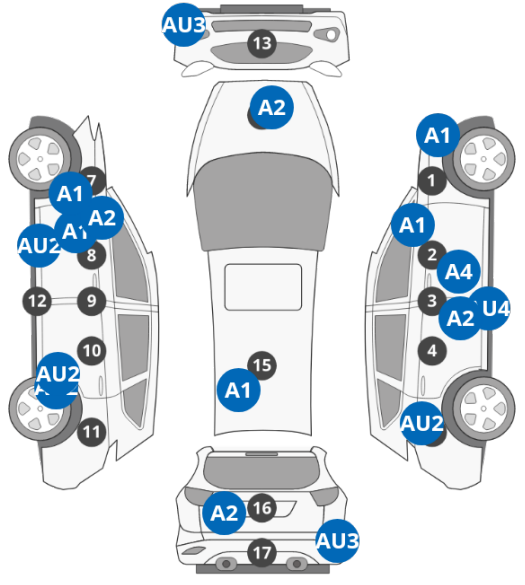
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	105	113	103
2	Boot Lid	89.6	89	93	87
3	Roof	112.7	117	128	100/106
4	Left Front Fender	93.3	99	88	93
5	Left Front Door	116.6	112	113	125
6	Center Panel Left				
7	Left Rear Door	110.6	109	110	113
8	Left Back Panel	110.0	119	106	105
9	Right Front Fender	94.8	100	91	94
10	Right Front Door	111.3	106	114	114
11	Center Panel Right				
12	Right Rear Door	114.0	114	105	123
13	Right Back Panel	100.4	103	93	105

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small / Ceiling - Crinkle - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate but not attached, fog lamps and plate light issue, possible flooding, scratches on headlight and tail light