

General Information

Date & Time: 15, Dec, 2025 13:15

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	3,111
Registration No.	CCQ1045	Chassis No.	PA1B18F36S4287866
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



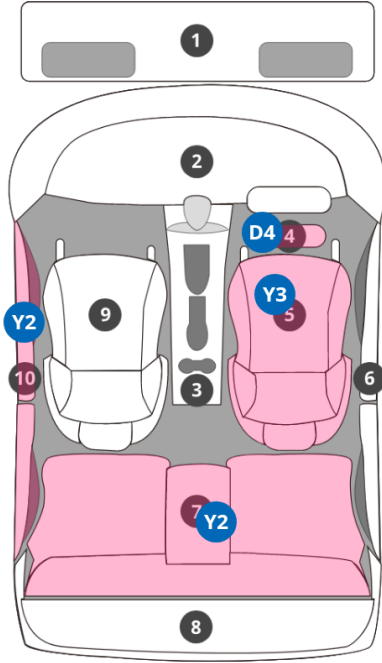
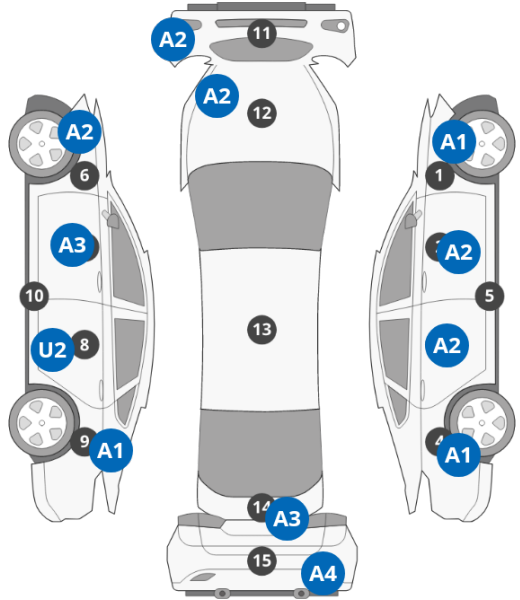
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.0	119	120	121
2	Boot Lid	109.3	107	112	109
3	Roof	105.7	116	100	99/108
4	Left Front Fender	107.6	111	110	102
5	Left Front Door	98.7	101	97	99
6	Center Panel Left				
7	Left Rear Door	99.8	108	97	94
8	Left Back Panel	105.6	109	102	106
9	Right Front Fender	110.0	108	108	114
10	Right Front Door	106.6	101	111	108
11	Center Panel Right				
12	Right Rear Door	107.3	98	118	106
13	Right Back Panel	110.6	110	104	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Large / (L) Front Trim - Grime - Small	Remarks (L) Rear Door, Molding - Dent - Small / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
incomplete tools/ with jack and sparetire/ with warranty booklet and LTO plate/