

General Information

Date & Time: 16, Dec, 2025 15:13

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,122
Registration No.	DBQ4079	Chassis No.	PA1B18F3XR4269137
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



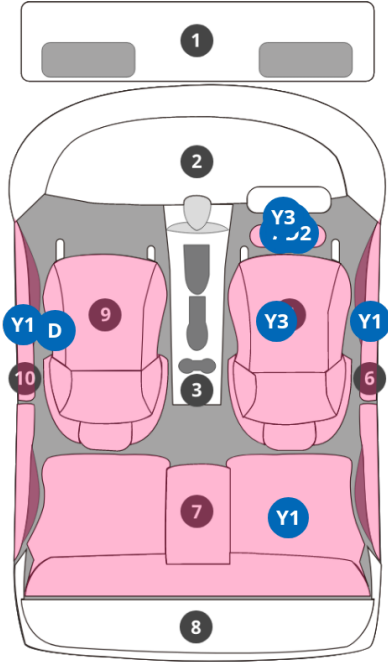
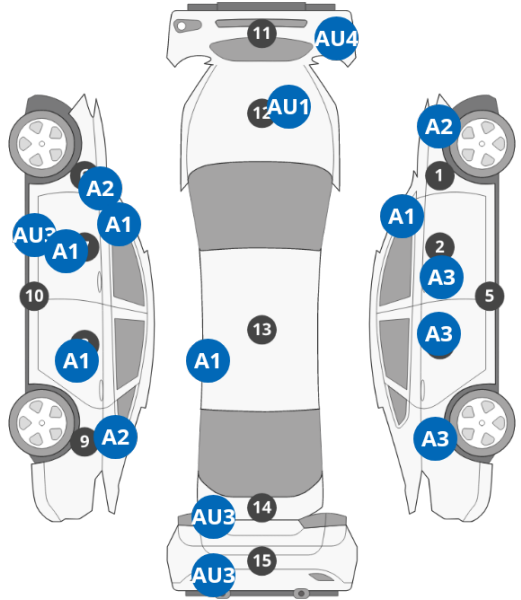
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	114	106	113
2	Boot Lid	111.0	105	111	117
3	Roof	97.7	99	100	92/99
4	Left Front Fender	98.2	96	101	97
5	Left Front Door	104.0	101	101	110
6	Center Panel Left				
7	Left Rear Door	116.0	123	116	109
8	Left Back Panel	112.3	117	114	106
9	Right Front Fender	106.6	106	108	106
10	Right Front Door	103.4	107	104	99
11	Center Panel Right				
12	Right Rear Door	109.3	107	104	117
13	Right Back Panel	109.3	109	107	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Mat Other - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratched and cracked tail light</p>