

General Information

Date & Time: 16, Dec, 2025 18:59

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	5,337
Registration No.	NJQ9690	Chassis No.	PA1B18F30S4296823
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



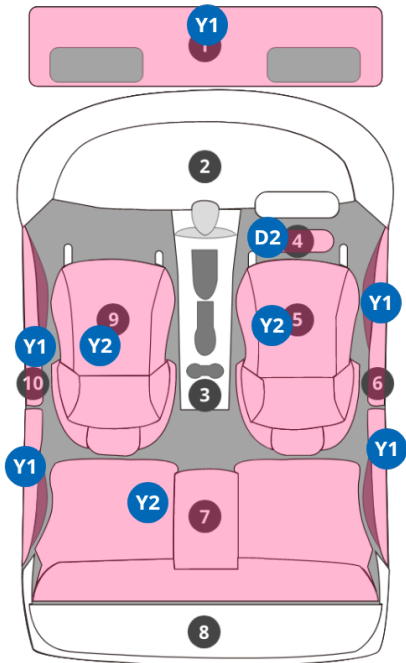
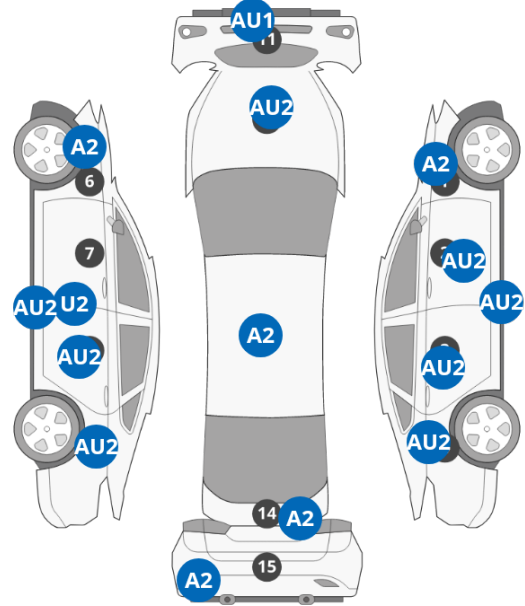
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	121	105	125
2	Boot Lid	114.6	115	116	113
3	Roof	142.7	160	116	95/200
4	Left Front Fender	104.0	101	106	105
5	Left Front Door	106.6	110	106	104
6	Center Panel Left				
7	Left Rear Door	106.6	109	109	102
8	Left Back Panel	118.3	123	114	118
9	Right Front Fender	110.5	120	113	99
10	Right Front Door	113.0	110	102	127
11	Center Panel Right				
12	Right Rear Door	134.6	120	142	142
13	Right Back Panel	113.0	112	106	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (R) Rear Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks Roof - Repair Traces - Yes / (L) Front Door, Molding - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
With reverse camera, with inc tools & jack, with spare tire, no spare key, no manual & warranty booklet, no LTO plate, scratches on taillight.