

## General Information

Date & Time: 16, Dec, 2025 10:30

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Hilux             |
| YOM              | 2023    | Odo Meter Reading | 29,042            |
| Registration No. | NHN1388 | Chassis No.       | MR0JB8DD1P3212121 |
| CC               | 2.4     | Transmission      | M/T               |
| Fuel Type        | Diesel  | Type of Body      | Pickup            |
| Colour           | White   |                   |                   |

## Body / Panel Condition



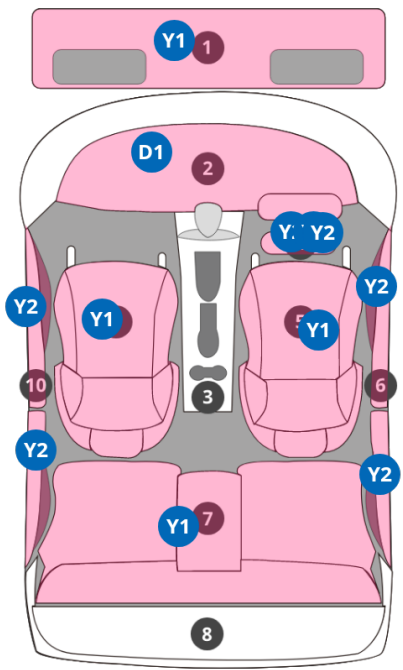
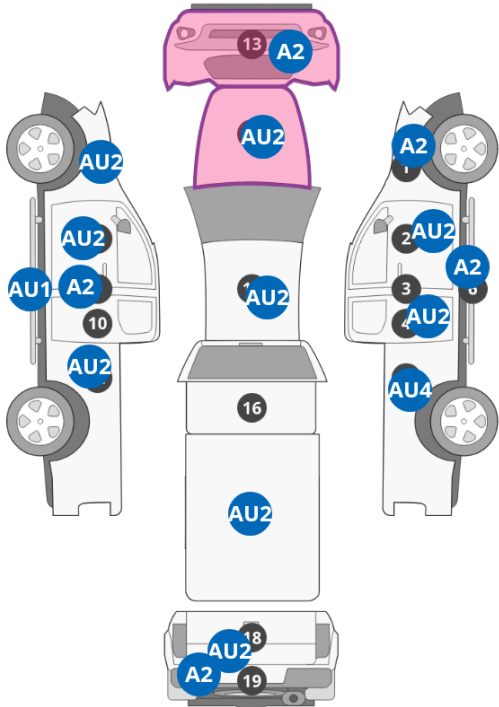
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 167.6         | 190    | 122    | 191      |
| 2  | Boot Lid           | 91.0          | 93     | 90     | 91       |
| 3  | Roof               | 240.7         | 159    | 103    | 104/597  |
| 4  | Left Front Fender  | 134.0         | 100    | 101    | 201      |
| 5  | Left Front Door    | 105.0         | 100    | 103    | 112      |
| 6  | Center Panel Left  | 133.3         | 116    | 158    | 126      |
| 7  | Left Rear Door     | 112.3         | 102    | 121    | 114      |
| 8  | Left Back Panel    | 111.6         | 117    | 102    | 116      |
| 9  | Right Front Fender | 107.3         | 112    | 101    | 109      |
| 10 | Right Front Door   | 105.4         | 96     | 115    | 105      |
| 11 | Center Panel Right | 132.3         | 138    | 126    | 133      |
| 12 | Right Rear Door    | 112.3         | 114    | 106    | 117      |
| 13 | Right Back Panel   | 106.3         | 104    | 112    | 103      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <div> <div>Interior Evaluation :</div> <div>B</div> </div>                                                                                                                                                                                                                                                                                                                                                                                        | <div> <div>Exterior Evaluation :</div> <div>E</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |
| <div>  </div> <div> <div>a : Cut, Fray</div> <div>d : Loose, Deformed</div> <div>k : Animal Hair</div> <div>s : Smell</div> <div>t : Cigarette Burns</div> <div>x : Defective</div> <div>y : Stain</div> </div>                                                                                                                                                 | <div>  </div> <div> <div>A : Scratch</div> <div>AU : Scratch &amp; Dent</div> <div>B : Modified</div> <div>C : Corrosion</div> <div>G : Stone chip</div> <div>P : Faded</div> <div>S : Rust</div> <div>SC : Rust &amp; Corrosion</div> <div>U : Dent</div> <div>X : Defective</div> <div>Y : Crack, Gap</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
| <div> <div>Remarks</div> <div>(R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Dashboard - Worked - Minimal / Ceiling - Grime - Minimal / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal</div> </div> | <div> <div>Remarks</div> <div>Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / Roof - Scratch &amp; Dent - Small / Cargo Bed Floor - Scratch &amp; Dent - Small / Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Guard Frame - Scratch &amp; Dent - Small / (L) Center Panel - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Side Gate - Scratch &amp; Dent - Large</div> </div> |
| <div> <div>Frame Evaluation :</div> <div>A</div> </div>                                                                                                                                                                                                                                                                                                                                                                                           | <div> <div>Functional Evaluation :</div> <div>B</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <div> <div>Remarks</div> <div>Defects not found</div> </div>                                                                                                                                                                                                                                                                                                                                                                                      | <div> <div>Remarks</div> <div>Battery - Weak - Yes</div> </div>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |

## Inspector Notes

with LTO plate, with manual warranty booklet, with reverse camera, with spare key, with spare tire, no tools & jack, scratches on taillight.