

General Information

Date & Time: 16, Dec, 2025 08:53

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	14,897
Registration No.	NHR8239	Chassis No.	PA1B18F39P4234554
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



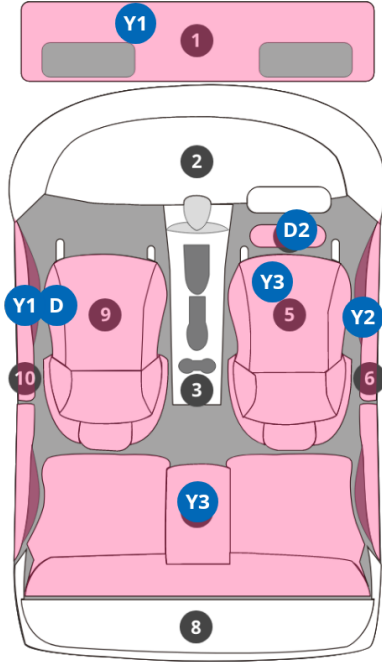
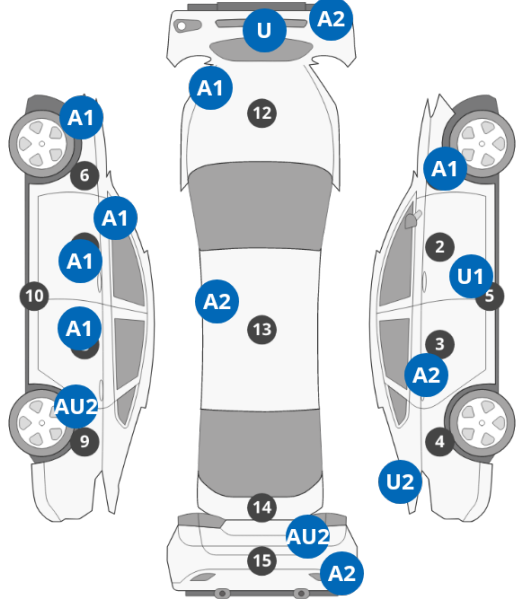
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	116	108	118
2	Boot Lid	100.1	96	99	106
3	Roof	115.5	119	123	111/109
4	Left Front Fender	150.4	182	173	96
5	Left Front Door	99.7	101	100	98
6	Center Panel Left				
7	Left Rear Door	105.1	113	107	95
8	Left Back Panel	109.3	118	110	100
9	Right Front Fender	95.5	91	90	106
10	Right Front Door	183.6	193	184	174
11	Center Panel Right				
12	Right Rear Door	98.6	98	99	99
13	Right Back Panel	106.0	109	105	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire and LTO PLATE, scratches on tail light