

General Information

Date & Time: 16, Dec, 2025 08:59

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	17,551
Registration No.	NJF1226	Chassis No.	MHKAA1BCORJ028408
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



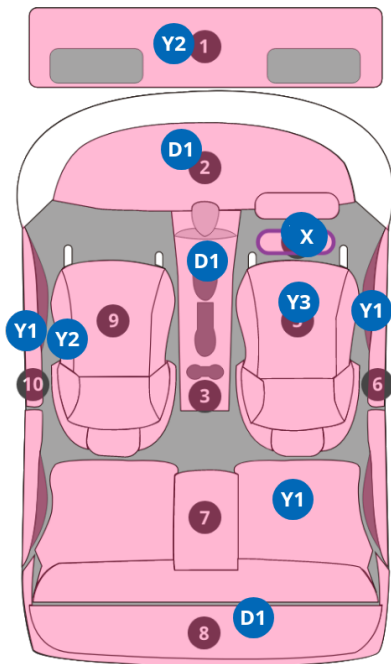
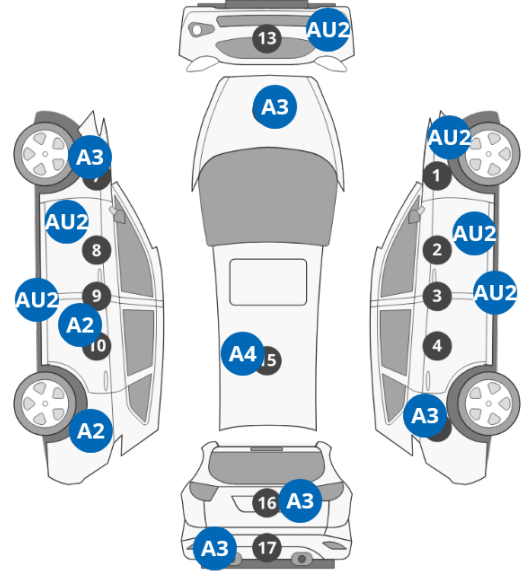
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.8	117	100	110
2	Boot Lid	79.9	79	83	78
3	Roof	86.3	94	76	93/82
4	Left Front Fender	97.9	96	97	101
5	Left Front Door	107.3	103	100	119
6	Center Panel Left				
7	Left Rear Door	103.7	112	93	106
8	Left Back Panel	90.1	93	86	91
9	Right Front Fender	93.7	111	93	77
10	Right Front Door	102.3	113	98	96
11	Center Panel Right				
12	Right Rear Door	107.5	111	99	113
13	Right Back Panel	91.2	91	89	93

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Worked - Minimal / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Console, Switchs, Vents - Worked - Minimal / Mat Other - Missing - Yes / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / Trunk Room - Worked - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty manual booklet, with reverse camera, no tools & jack, no spare key, no spare tire, aircon issue, trunk cover missing, scratches on taillight.</p>