

General Information

Date & Time: 16, Dec, 2025 11:03

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,621
Registration No.	NJF2686	Chassis No.	PA1B18F36R4274321
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



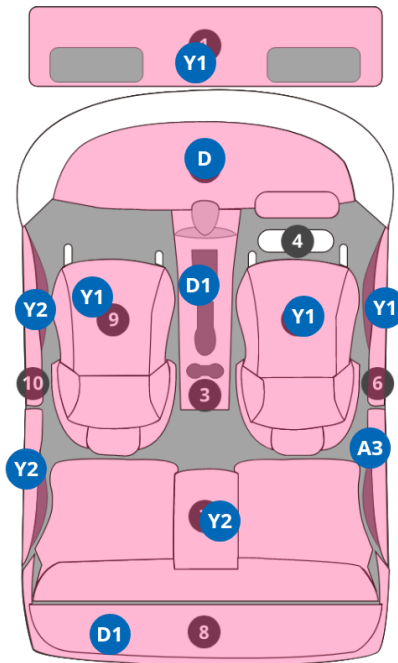
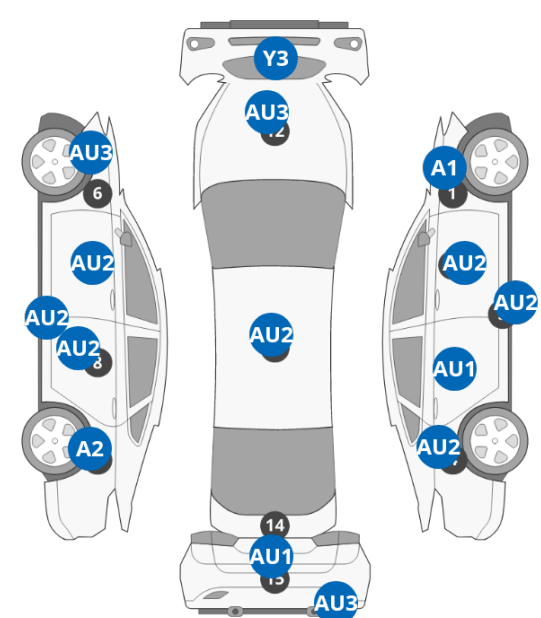
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	122	102	128
2	Boot Lid	111.6	104	113	118
3	Roof	98.1	97	94	100/102
4	Left Front Fender	113.7	120	98	123
5	Left Front Door	102.3	101	104	102
6	Center Panel Left				
7	Left Rear Door	99.0	102	93	102
8	Left Back Panel	107.1	110	112	99
9	Right Front Fender	113.0	106	100	133
10	Right Front Door	113.3	100	100	140
11	Center Panel Right				
12	Right Rear Door	103.6	105	102	104
13	Right Back Panel	108.6	103	100	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / (R) Rear Trim - Cut, Crack - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Console, Switches, Vents - Worked - Minimal / Trunk Room - Worked - Minimal	Remarks Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Horn - Issue - Yes

Inspector Notes
with LTO plate, with manual & warranty booklet, with reverse camera, with spare tire, with incomplete tools & jack, with spare key, scratches on taillight.