

General Information

Date & Time: 16, Dec, 2025 09:56

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	7,231
Registration No.	NKU1045	Chassis No.	PA1B18F34S4294881
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



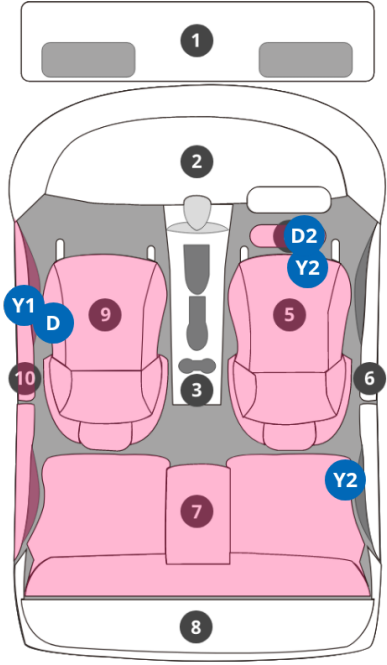
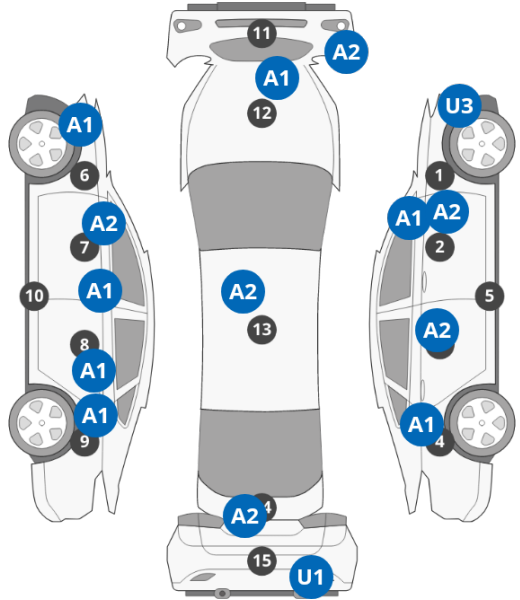
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	119	117	130
2	Boot Lid	112.3	114	106	117
3	Roof	109.5	112	113	106/107
4	Left Front Fender	106.0	105	105	108
5	Left Front Door	106.0	108	105	105
6	Center Panel Left				
7	Left Rear Door	108.3	113	107	105
8	Left Back Panel	116.3	119	117	113
9	Right Front Fender	105.3	106	105	105
10	Right Front Door	107.6	107	109	107
11	Center Panel Right				
12	Right Rear Door	103.1	111	96	102
13	Right Back Panel	114.0	110	113	119

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Small	Remarks (R) Front Fender, Molding - Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with warranty booklet, jack and tools, with spare tire and LTO PLATE, scratches on tail light