

General Information

Date & Time: 19, Dec, 2025 15:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	7,980
Registration No.	DBU8135	Chassis No.	PA1B18F3XS4289104
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



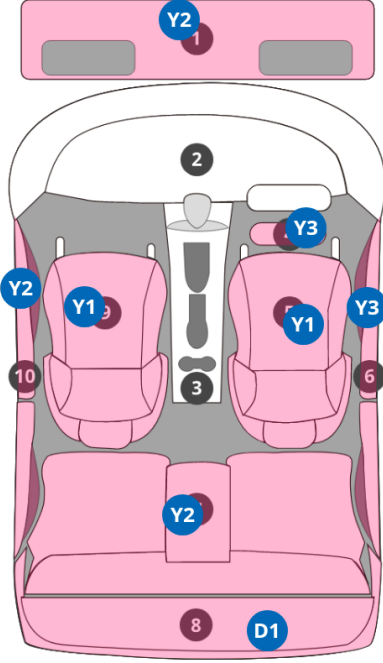
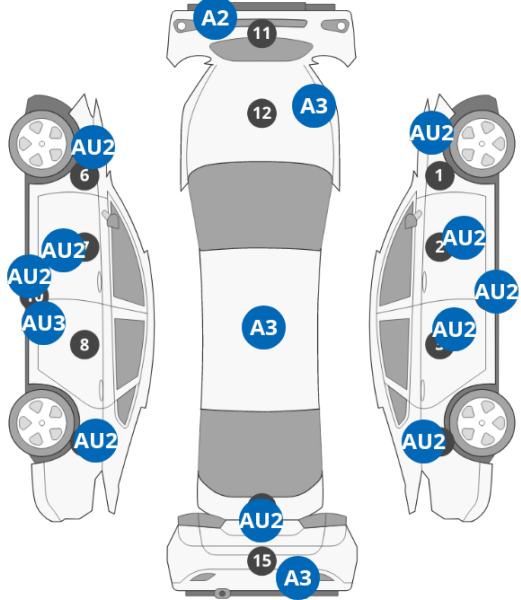
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	169.3	134	261	113
2	Boot Lid	115.0	111	109	125
3	Roof	119.2	123	110	116/128
4	Left Front Fender	146.6	116	106	218
5	Left Front Door	108.0	109	107	108
6	Center Panel Left				
7	Left Rear Door	121.3	146	113	105
8	Left Back Panel	113.3	111	120	109
9	Right Front Fender	125.0	126	116	133
10	Right Front Door	113.6	111	117	113
11	Center Panel Right				
12	Right Rear Door	141.6	142	117	166
13	Right Back Panel	134.0	164	110	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Trunk Room - Worked - Minimal</p>	<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with manual & warranty booklet, with reverse camera, with inc tools & jack, with spare key, no spare tire, scratches on taillight.</p>