

General Information

Date & Time: 06, Jan, 2026 13:54

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,941
Registration No.	HAH5890	Chassis No.	PA1B18F32R4279645
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



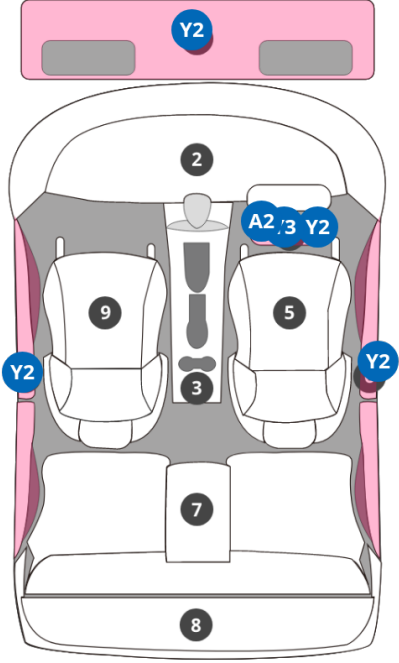
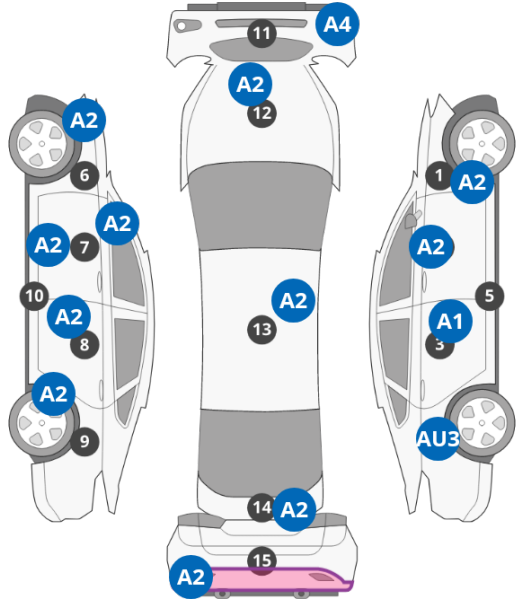
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.8	115	99	119
2	Boot Lid	102.6	96	106	106
3	Roof	103.4	99	107	104/104
4	Left Front Fender	155.0	165	157	143
5	Left Front Door	102.4	96	105	106
6	Center Panel Left				
7	Left Rear Door	106.3	110	107	102
8	Left Back Panel	112.3	127	105	105
9	Right Front Fender	156.6	148	165	157
10	Right Front Door	104.6	104	106	104
11	Center Panel Right				
12	Right Rear Door	110.3	104	113	114
13	Right Back Panel	108.0	103	103	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / Mat Other - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With warranty booklet and seat cover. Incomplete tools. Without spare tire and jack. 2 keys. With LTO plate.