

General Information

Date & Time: 17, Dec, 2025 14:58

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	10,903
Registration No.	NKO9362	Chassis No.	JTFJT02P9S5040564
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



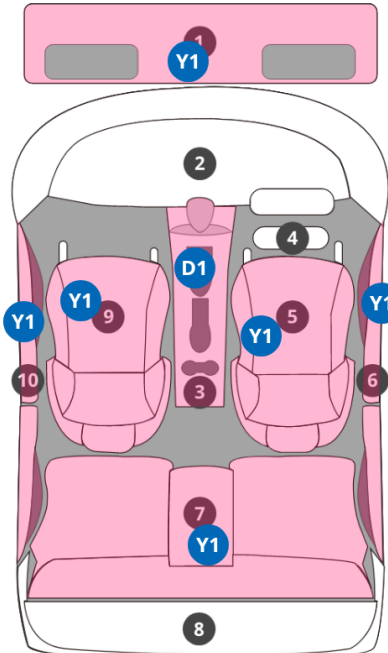
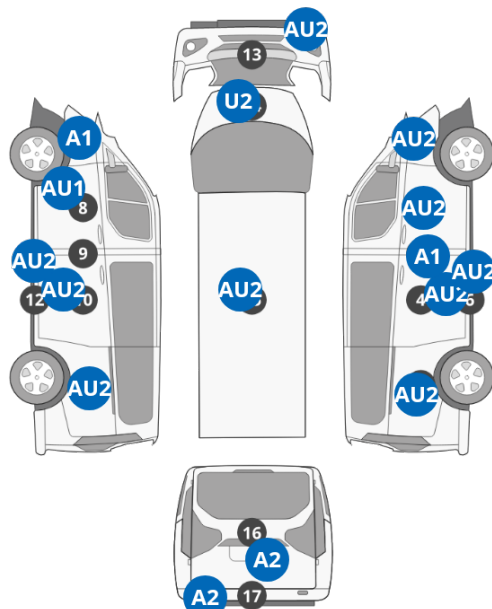
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.3	118	115	125
2	Boot Lid	110.3	117	103	111
3	Roof	150.2	128	209	137/127
4	Left Front Fender	127.0	138	126	117
5	Left Front Door	114.3	114	113	116
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	123.6	123	121	127
9	Right Front Fender	115.0	107	119	119
10	Right Front Door	117.3	117	113	122
11	Center Panel Right	126.6	130	124	126
12	Right Rear Door	117.0	122	113	116
13	Right Back Panel	118.0	129	117	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A		Exterior Evaluation : C	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Console, Switchs, Vents - Worked - Minimal		Remarks Roof - Repair Traces - Yes / Front Panel - Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Center Panel - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with LTO plate, with warranty & manual booklet, with spare tire, with jack & inc tools, no reverse camera, no spare key, scratches on taillight.