

General Information

Date & Time: 16, Dec, 2025 15:08

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,482
Registration No.	NKE7280	Chassis No.	PA1B18F32R4264045
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



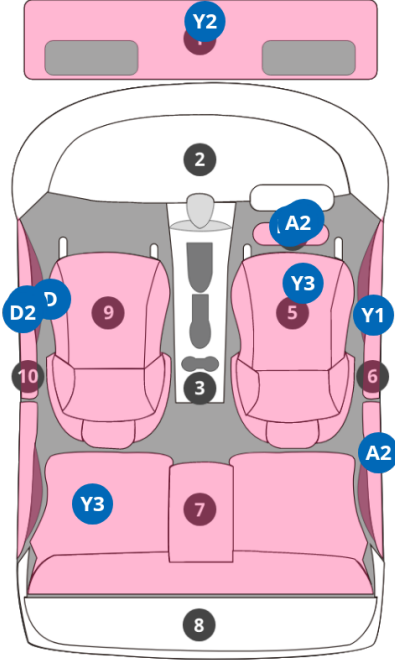
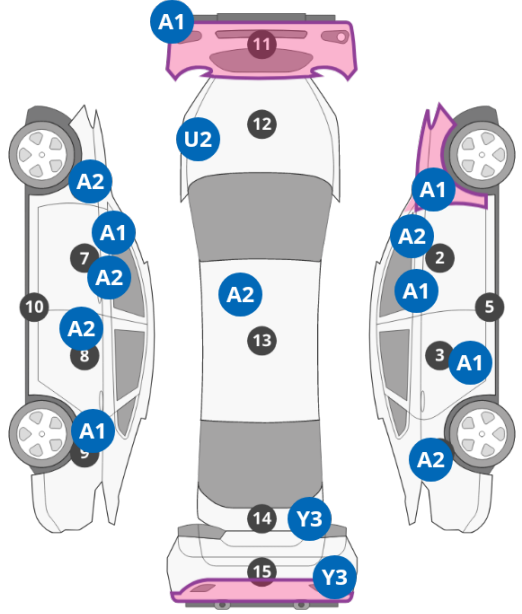
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.6	121	120	124
2	Boot Lid	188.0	247	203	114
3	Roof	107.7	120	100	110/101
4	Left Front Fender	108.0	109	105	110
5	Left Front Door	112.0	112	115	109
6	Center Panel Left				
7	Left Rear Door	119.3	124	125	109
8	Left Back Panel	113.3	120	109	111
9	Right Front Fender	149.6	139	142	168
10	Right Front Door	113.3	113	117	110
11	Center Panel Right				
12	Right Rear Door	120.3	121	115	125
13	Right Back Panel	115.6	113	117	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / (L) Front Floor Mat - Worked - Small / Carpet - Worn, Scratch, Cut, Crack - Small / (R) Rear Trim - Cut, Crack - Small	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Dent - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, scratched and cracked tail light