

General Information

Date & Time: 17, Dec, 2025 10:50

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	55,749
Registration No.	NFR5228	Chassis No.	PA1B18F34R4253130
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



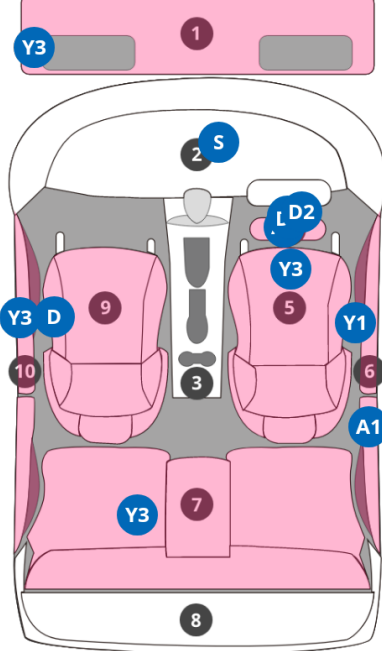
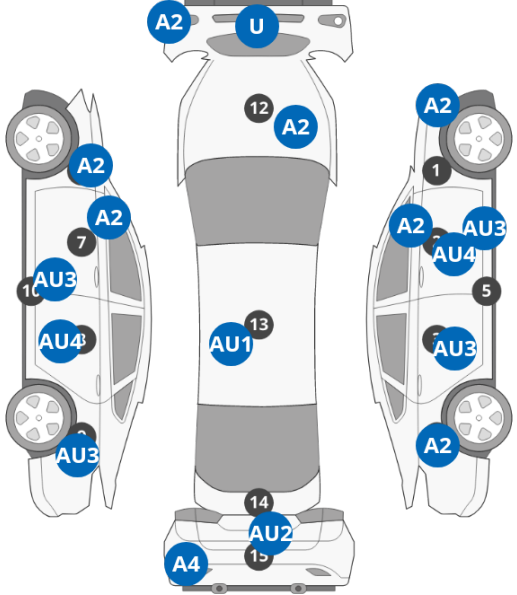
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.0	117	117	123
2	Boot Lid	116.3	111	113	125
3	Roof	105.5	111	100	105/106
4	Left Front Fender	103.6	103	101	107
5	Left Front Door	115.6	118	120	109
6	Center Panel Left				
7	Left Rear Door	120.3	122	116	123
8	Left Back Panel	116.6	120	116	114
9	Right Front Fender	113.6	113	112	116
10	Right Front Door	119.6	126	118	115
11	Center Panel Right				
12	Right Rear Door	119.3	117	126	115
13	Right Back Panel	112.3	117	110	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Cut, Crack - Large / Overall Interior - Smell - Yes / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, plate light issue, with pending appreciation disregard traffic light 1000