

General Information

Date & Time: 17, Dec, 2025 16:25

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	15,694
Registration No.	DBI2176	Chassis No.	PA1B18F30P4213768
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



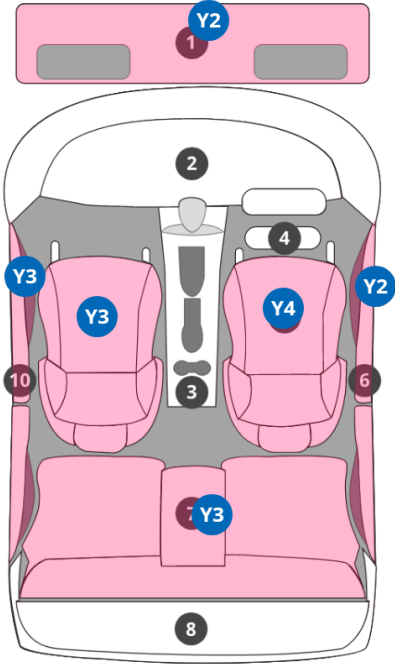
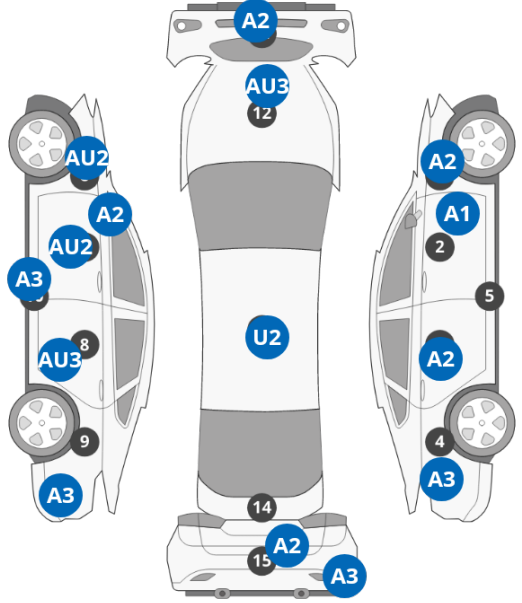
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	116	110	123
2	Boot Lid	112.0	106	115	115
3	Roof	92.6	101	91	87/92
4	Left Front Fender	101.6	102	102	101
5	Left Front Door	101.6	100	100	105
6	Center Panel Left				
7	Left Rear Door	97.5	102	96	95
8	Left Back Panel	110.0	126	104	100
9	Right Front Fender	98.6	98	102	96
10	Right Front Door	103.3	103	99	108
11	Center Panel Right				
12	Right Rear Door	103.6	101	100	110
13	Right Back Panel	104.2	97	106	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Rear Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Dent - Small / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare key/with jack and incomplete tools/No reverse camera/No warranty booklet