

General Information

Date & Time: 17, Dec, 2025 15:06

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	32,337
Registration No.	NJF2071	Chassis No.	PA1B18F32R4277801
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



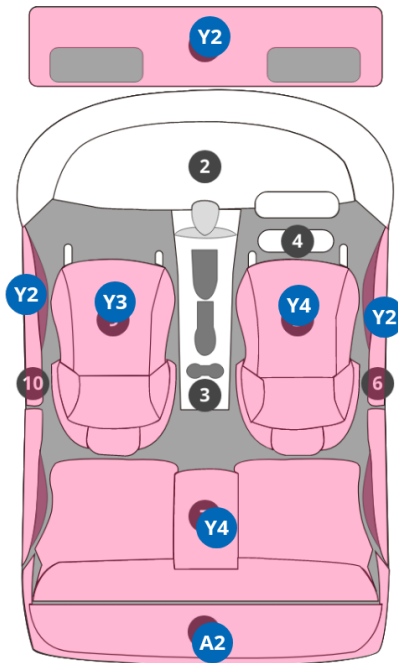
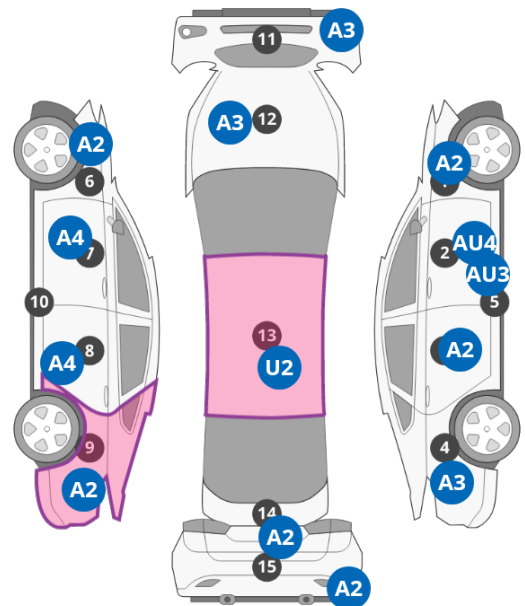
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	133	104	125
2	Boot Lid	105.7	99	105	113
3	Roof	93.3	89	95	86/103
4	Left Front Fender	101.2	103	103	98
5	Left Front Door	100.3	103	100	98
6	Center Panel Left				
7	Left Rear Door	113.3	113	117	110
8	Left Back Panel	673.0	1,177	621	221
9	Right Front Fender	108.0	107	108	109
10	Right Front Door	101.3	110	97	97
11	Center Panel Right				
12	Right Rear Door	102.5	96	97	114
13	Right Back Panel	101.9	100	102	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Roof - Dent - Small / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

with LTO plate/with spare tire/with spare key/with jack and incomplete/rear seat issue/with reverse camera/with warranty booklet/left side front door issue