

General Information

Date & Time: 17, Dec, 2025 19:24

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	38,447
Registration No.	NHJ7335	Chassis No.	MHKE8FF3PPK056206
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



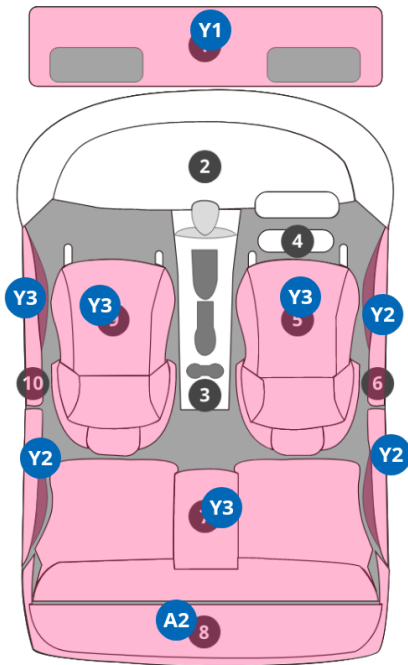
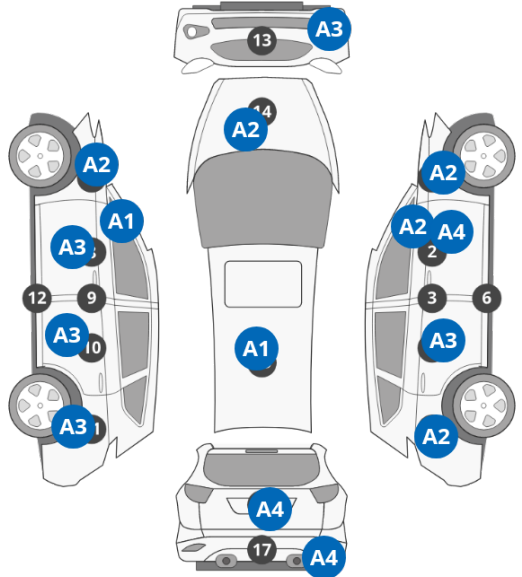
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.3	113	91	103
2	Boot Lid	91.2	94	89	91
3	Roof	104.1	94	89	125/109
4	Left Front Fender	96.4	87	98	104
5	Left Front Door	105.2	110	100	106
6	Center Panel Left				
7	Left Rear Door	108.3	117	105	103
8	Left Back Panel	102.3	111	101	95
9	Right Front Fender	100.6	108	100	94
10	Right Front Door	107.0	108	103	110
11	Center Panel Right				
12	Right Rear Door	104.0	100	103	109
13	Right Back Panel	99.1	105	92	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/No spare key/with jack and incomplete tools/with reverse camera/No warranty booklets