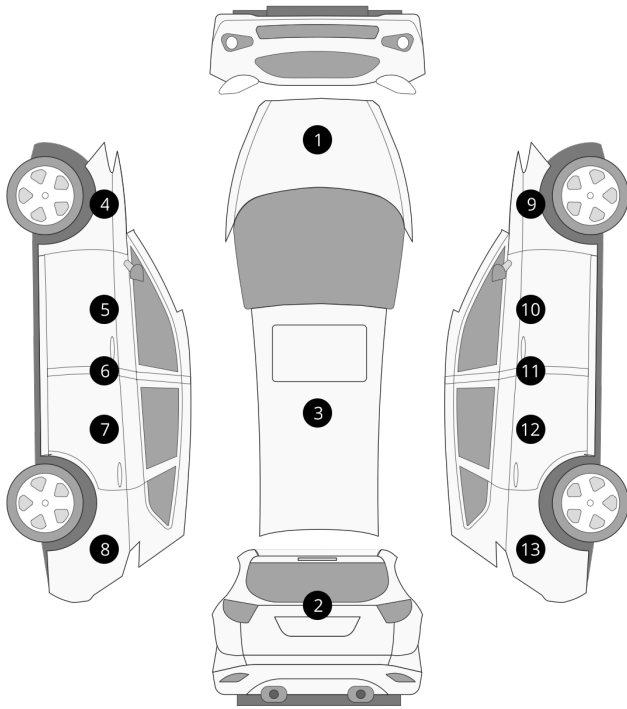


General Information

Date & Time: 05, Jan, 2026 08:52

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	41,188
Registration No.	DBO7141	Chassis No.	PA1B18F37R4257012
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



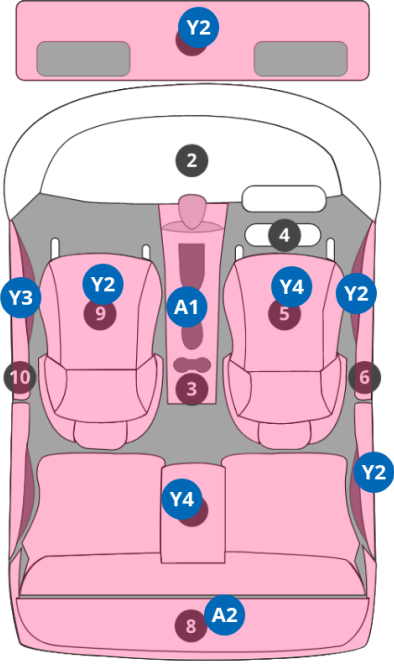
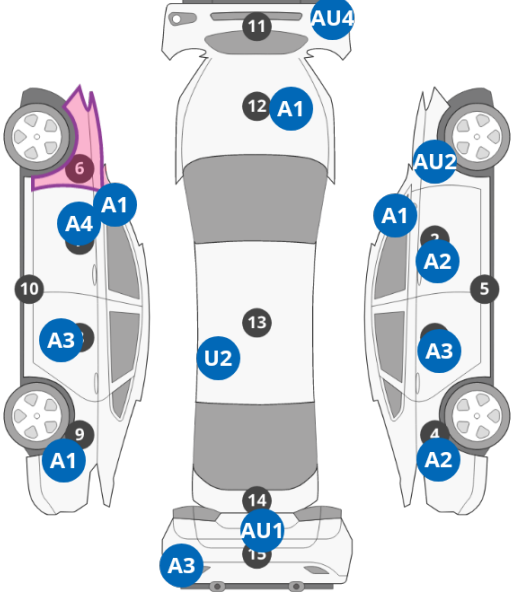
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	111	104	113
2	Boot Lid	96.1	92	94	102
3	Roof	94.4	102	93	88/95
4	Left Front Fender	178.0	166	179	189
5	Left Front Door	93.5	97	91	92
6	Center Panel Left				
7	Left Rear Door	98.0	112	94	88
8	Left Back Panel	99.5	100	100	99
9	Right Front Fender	99.4	100	100	99
10	Right Front Door	99.2	100	97	101
11	Center Panel Right				
12	Right Rear Door	149.6	132	159	158
13	Right Back Panel	99.9	98	96	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No jack and tools/with 1 spare key/with reverse camera/with warranty booklet</p>