

General Information

Date & Time: 18, Dec, 2025 16:01

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	42,277
Registration No.	NHU2298	Chassis No.	PA1B18F37P4235220
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



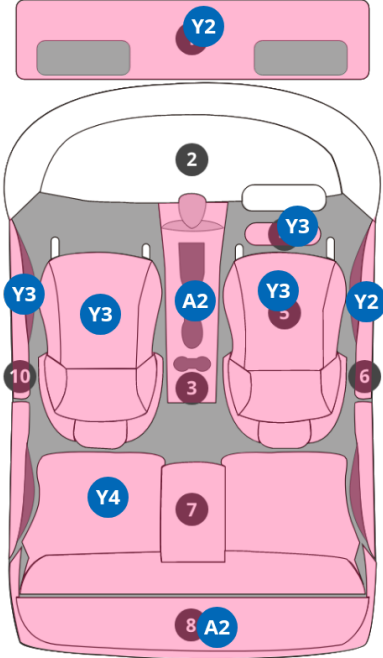
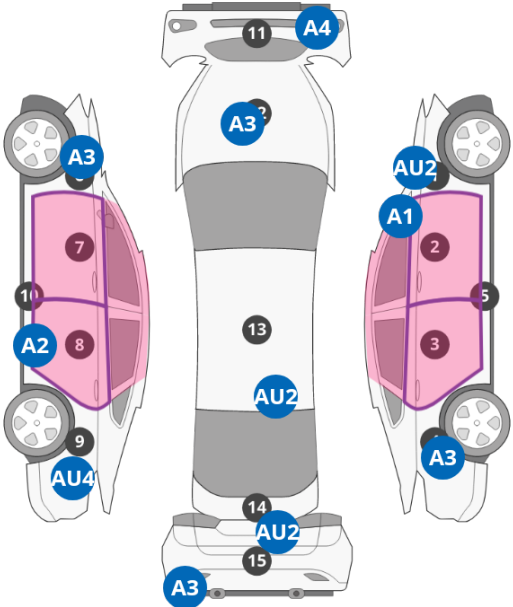
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.3	134	101	114
2	Boot Lid	104.0	100	106	106
3	Roof	95.8	96	97	93/98
4	Left Front Fender	97.4	95	98	100
5	Left Front Door	232.6	102	311	285
6	Center Panel Left				
7	Left Rear Door	275.3	295	262	269
8	Left Back Panel	112.2	138	104	95
9	Right Front Fender	152.6	145	139	174
10	Right Front Door	236.3	247	232	230
11	Center Panel Right				
12	Right Rear Door	233.0	232	229	238
13	Right Back Panel	105.1	100	100	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and incomplete tools/No reverse camera/No warranty booklet/Fog lights issue/left front door issue/rear seat issue/ front bumper with clamp support</p>