

General Information

Date & Time: 18, Dec, 2025 15:14

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,480
Registration No.	NKE3988	Chassis No.	PA1B18F38R4259156
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



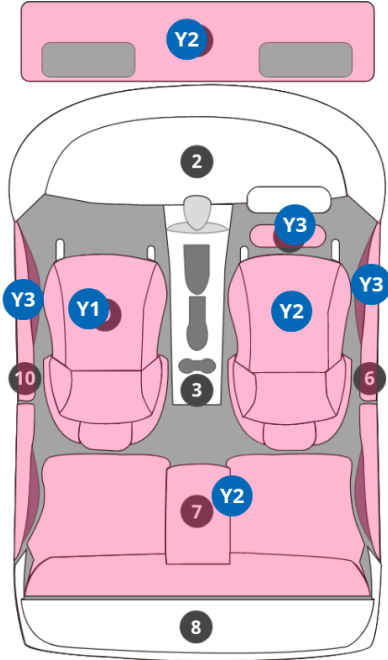
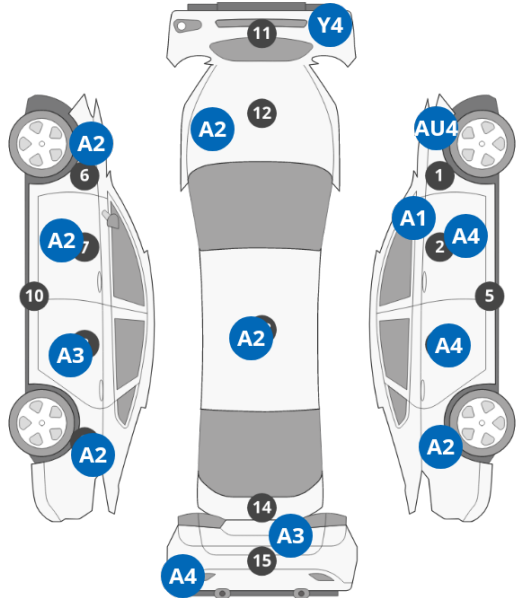
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.1	123	94	113
2	Boot Lid	98.3	92	101	102
3	Roof	92.9	100	91	88/92
4	Left Front Fender	101.6	100	100	105
5	Left Front Door	101.0	95	108	100
6	Center Panel Left				
7	Left Rear Door	106.0	114	103	101
8	Left Back Panel	110.3	120	104	107
9	Right Front Fender	101.1	107	95	101
10	Right Front Door	99.2	100	99	99
11	Center Panel Right				
12	Right Rear Door	97.8	102	92	100
13	Right Back Panel	103.1	100	96	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/No spare tire/No spare key/with jack No tools/with reverse camera/No warranty booklet</p>