

General Information

Date & Time: 05, Jan, 2026 10:48

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,845
Registration No.	GBE4941	Chassis No.	PA1B18F3XR4252905
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



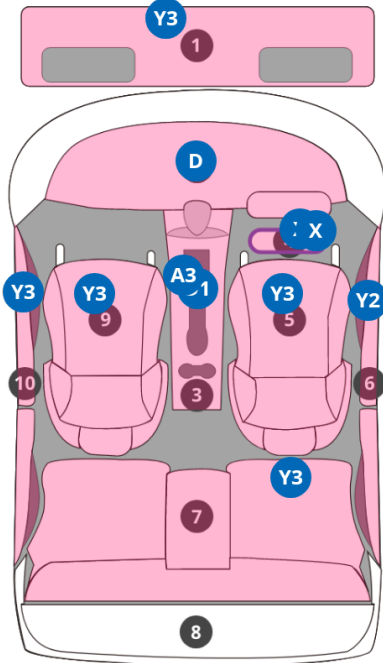
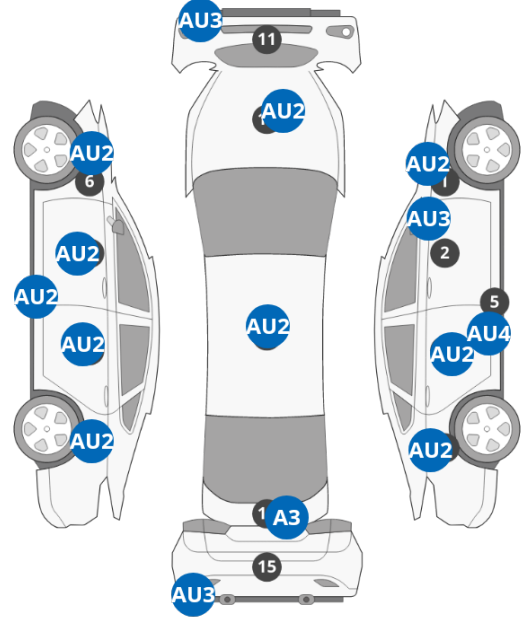
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	107	110	103
2	Boot Lid	105.0	107	103	105
3	Roof	106.6	116	99	103/109
4	Left Front Fender	97.3	101	94	97
5	Left Front Door	95.8	105	88	95
6	Center Panel Left				
7	Left Rear Door	111.0	109	100	124
8	Left Back Panel	102.1	108	101	97
9	Right Front Fender	109.6	112	113	104
10	Right Front Door	109.0	111	106	110
11	Center Panel Right				
12	Right Rear Door	108.7	99	107	120
13	Right Back Panel	113.6	107	104	130

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Console, Switchs, Vents - Worked - Minimal / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with spare key, with warranty & manual booklet, with inc tools & jack, with reverse camera, scratches on taillight & headlight.</p>