

General Information

Date & Time: 16, Jan, 2026 10:20

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	11,175
Registration No.	DBS7415	Chassis No.	PA1B18F39R4277438
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



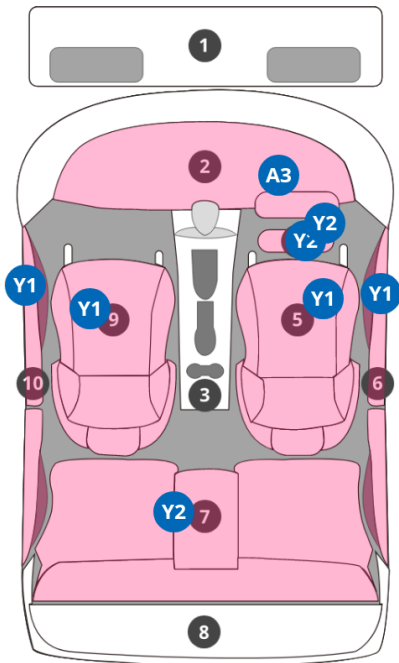
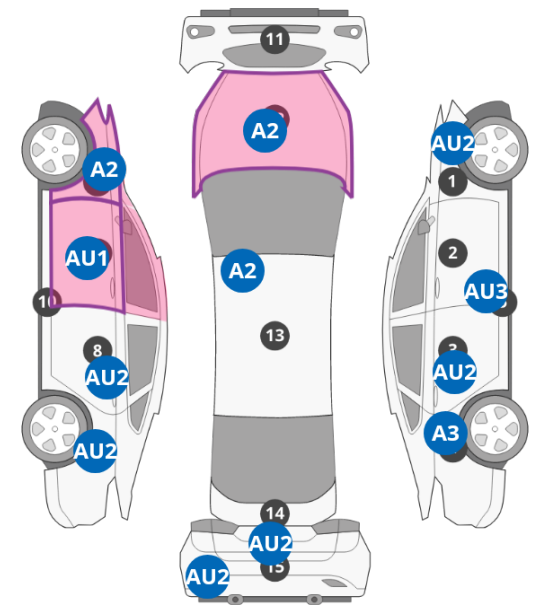
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	130.0	143	115	132
2	Boot Lid	117.6	114	110	129
3	Roof	104.8	96	104	110/109
4	Left Front Fender	484.6	720	288	446
5	Left Front Door	181.3	268	134	142
6	Center Panel Left				
7	Left Rear Door	107.9	116	97	111
8	Left Back Panel	112.7	128	117	93
9	Right Front Fender	110.6	120	108	104
10	Right Front Door	109.4	120	110	98
11	Center Panel Right				
12	Right Rear Door	108.0	98	100	126
13	Right Back Panel	111.3	101	114	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Worn, Scratch, Cut, Crack - Medium / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium</p>
Frame Evaluation : D	Functional Evaluation : B
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with reverse camera, incomplete tools and jack, with manual booklet, no warranty, no spare key, scratches on taillight</p>