

General Information

Date & Time: 17, Dec, 2025 12:43

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	51,386
Registration No.	NEN8463	Chassis No.	PA1B18F32N4183962
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



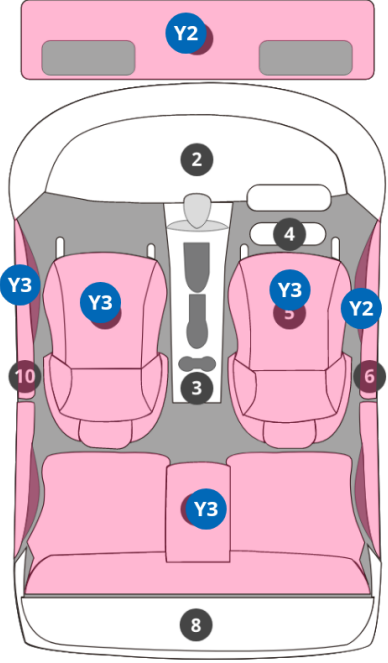
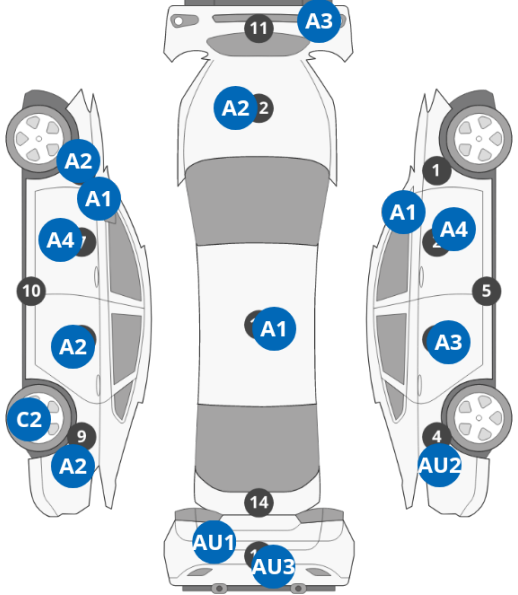
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.4	123	96	109
2	Boot Lid	103.4	102	99	109
3	Roof	91.4	94	90	91/91
4	Left Front Fender	101.6	99	99	107
5	Left Front Door	103.4	112	105	93
6	Center Panel Left				
7	Left Rear Door	108.6	105	111	110
8	Left Back Panel	113.6	121	109	111
9	Right Front Fender	97.2	100	97	95
10	Right Front Door	99.5	97	101	101
11	Center Panel Right				
12	Right Rear Door	101.0	93	103	107
13	Right Back Panel	106.9	95	103	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / Roof - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Wheel, Cover - Scratch, Corrosion - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No spare key/rear seat issue/with jack and incomplete tools/No reverse camera/with warranty booklet/No fog light</p>