

General Information

Date & Time: 17, Dec, 2025 15:55

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	16,925
Registration No.	NHS8439	Chassis No.	MR0JB8DD4R3232320
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



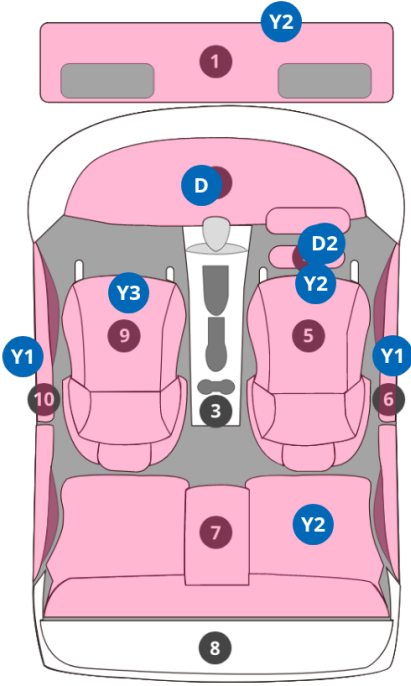
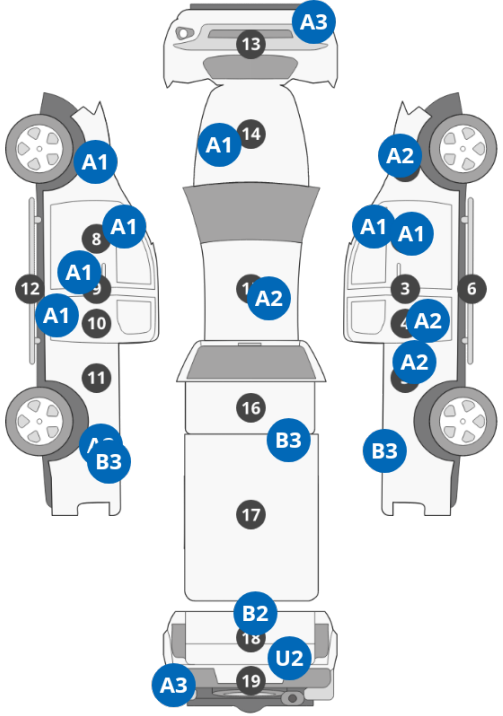
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	114	126	111
2	Boot Lid	125.3	156	110	110
3	Roof	114.5	114	120	112/112
4	Left Front Fender	116.0	112	113	123
5	Left Front Door	122.6	133	113	122
6	Center Panel Left				
7	Left Rear Door	123.0	133	119	117
8	Left Back Panel	114.6	114	113	117
9	Right Front Fender	112.3	111	113	113
10	Right Front Door	109.6	111	109	109
11	Center Panel Right				
12	Right Rear Door	122.0	108	109	149
13	Right Back Panel	109.0	110	109	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / Mat Other - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Small / (L) Side Gate - Scratch - Small / Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Side Gate - Modified - Medium / (L) Side Gate - Modified - Medium / Cab Back Panel - Modified - Medium / Rear Gate - Modified - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light,