

## General Information

Date & Time: 17, Dec, 2025 16:16

|                         |         |                          |                   |
|-------------------------|---------|--------------------------|-------------------|
| <b>Make</b>             | Toyota  | <b>Model</b>             | Vios              |
| <b>YOM</b>              | 2024    | <b>Odo Meter Reading</b> | 13,164            |
| <b>Registration No.</b> | DBO7316 | <b>Chassis No.</b>       | PA1B18F34R4254990 |
| <b>CC</b>               | 1.3     | <b>Transmission</b>      | CVT               |
| <b>Fuel Type</b>        | Gas     | <b>Type of Body</b>      | Sedan             |
| <b>Colour</b>           | Silver  |                          |                   |

## Body / Panel Condition



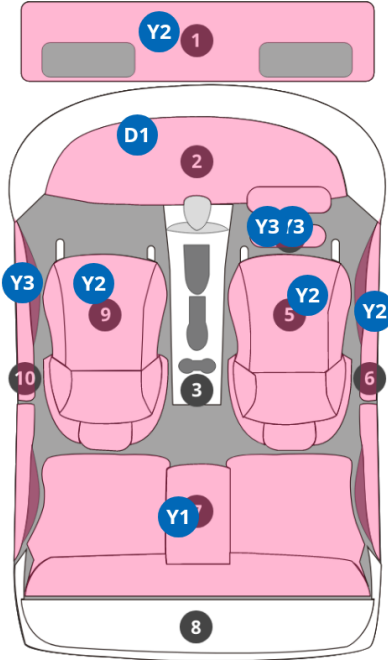
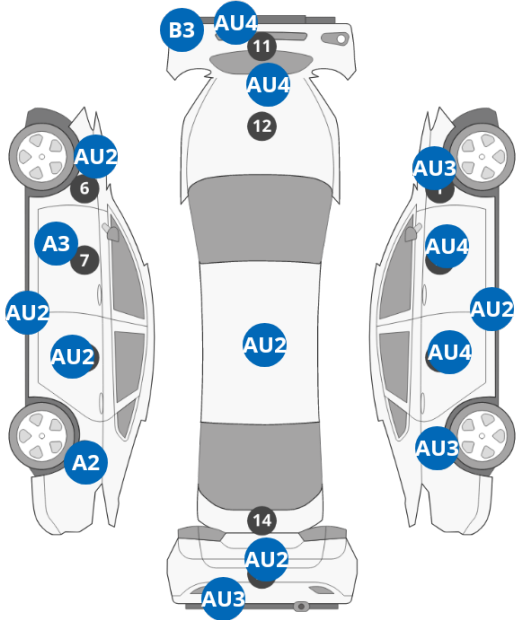
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 63.9          | 61     | 63     | 68       |
| 2  | Boot Lid           | 72.6          | 68     | 74     | 76       |
| 3  | Roof               | 86.9          | 81     | 111    | 69/87    |
| 4  | Left Front Fender  | 80.4          | 87     | 83     | 71       |
| 5  | Left Front Door    | 92.7          | 70     | 128    | 80       |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 100.8         | 77     | 86     | 140      |
| 8  | Left Back Panel    | 97.1          | 89     | 87     | 116      |
| 9  | Right Front Fender | 129.6         | 119    | 128    | 142      |
| 10 | Right Front Door   | 90.6          | 57     | 77     | 138      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 67.7          | 73     | 69     | 62       |
| 13 | Right Back Panel   | 63.8          | 65     | 63     | 64       |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

|                                                                                                                                                                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>                                                                                                                                                                                                                                  | <b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |
| <p><b>Remarks</b><br/>Dashboard - Worked - Minimal / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Small</p> | <p><b>Remarks</b><br/>Roof - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small / Bonnet, Headlight - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Modified - Medium / (R) Front Fender, Molding - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Rear Door, Molding - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium</p> |
| <b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>                                                                                                                                                                                                                                     | <b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                 |
| <p><b>Remarks</b><br/>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right<br/>Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left<br/>Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>                     | <p><b>Remarks</b><br/>Battery - Weak - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |

|                                                                                                                                                             |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p><b>Inspector Notes</b></p>                                                                                                                               |
| <p>with LTO plate, with warranty &amp; manual booklet, with reverse camera, with spare tire, no spare key, no tools &amp; jack, scratches on taillight.</p> |