

General Information

Date & Time: 17, Dec, 2025 16:57

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	16,120
Registration No.	DBM6648	Chassis No.	PA1B18F32R4247584
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



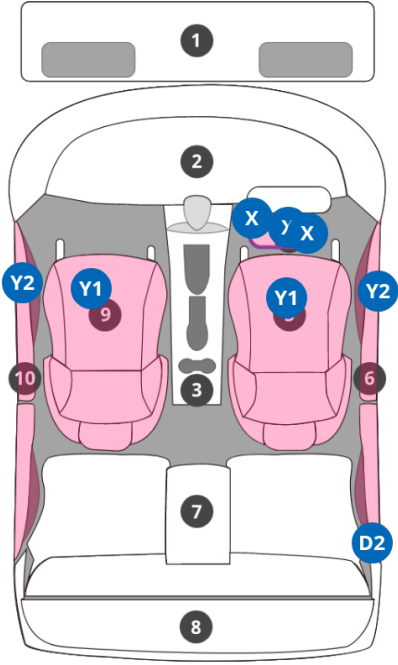
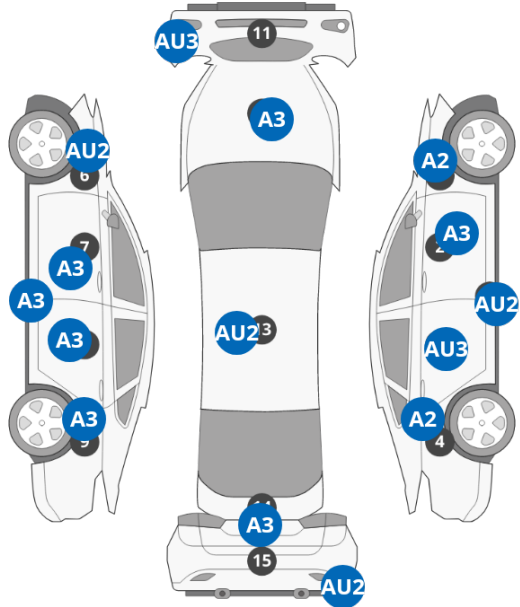
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	138	136	120
2	Boot Lid	99.4	123	75	100
3	Roof	115.7	139	102	127/95
4	Left Front Fender	118.8	148	131	78
5	Left Front Door	99.2	63	135	100
6	Center Panel Left				
7	Left Rear Door	109.4	121	92	115
8	Left Back Panel	70.8	73	63	77
9	Right Front Fender	100.7	107	124	71
10	Right Front Door	95.9	121	76	90
11	Center Panel Right				
12	Right Rear Door	108.7	84	110	132
13	Right Back Panel	102.2	104	93	110

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Trim Other - Loose, Deformed - Small	Remarks Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with manual & warranty booklet, with reverse camera, with inc tools & jack, no spare key, no spare tire, scratches on taillight.